

Building Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

INSPECTION REPORT

Date of Inspection: Jun 21, 2024 Inspection Result: FAILED

Permit Number: PRMU20221586

Property Address: 4002 10TH ST SE, PUYALLUP, WA 98374;

Contractor: BRC FAMILY LLC PO BOX 731310 PUYALLUP, WA 98373-0060 **To construct:** South Building of CopperBerry, R-2 Apartments 6 Plex and 600 sq ft

commercial office space: IMPACT FEE DEFERRAL CIVIL: PRCCP20221569
- REVISION (1) - 09/11/2023 - POURING 5'7" FOUNDATION WALL ON
THE WEST WALL INSTEAD OF A 4' FOUNDATION WALL * REV (2) 12/14/2023 - FOOTING & FOUNDATION NOT NEEDED FOR WEST
STAIRCASE LOAD AS PER STURUCTURAL ENGINEER. PEPLACE WITH
PIERS AS PER DRAWINGS & CALS * REV (3) - 5/24/2024 - REQEUSTED

FIRE RATING FOR INSPECTOR

On this day we have inspected your construction for **Frame Inspection** and we find the following result of the inspection. If there are any questions, please contact the inspector below.

Comments:

Corrections:

1 date of inspection 6/14/2024

at the request of contractor we inspected the commercial space and one upper unit and one lower unit

COMMERCIAL SPACE

- 1. complete fir blocking at drop ceiling in bathroom
- 2. complete all fire stop
- 3.complete sole plate nailing per city approved plans
- 4. provide access at front wall to verify beams

UNITS

- 1. complete strapping at top plates
- 2.complete fire stop
- 3. complete headers per city approved plans



Building Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

- 4.complete sole plat nailing per city approved plans
- 5. tighten all nuts at hold downs
- 6.provide truss specs that match what is on site
- 7.not a complete list
- 2 office
 - 1; complete all firestop as per last frame inspection.
 - 2; complete install of PHD2's at west wall as per plans.
 - 3; complete bottom plate nailing at P13 shearwall.
 - 4; provide ledger attachment from engineer at east wall.
 - 5; complete blocking for grab bars in restrooms.
 - 6; provide access to inspect headers at east wall as noted on last framing inspection.
 - 7; test failed at d.w.v., supply approved.

unit 101

- 1; provide engineers fix or approval for head out of floor joist at all units.
- 2; tighten nuts on all hold down as noted on last inspection.
- 3; no back to back electrical boxes at rated walls, (provide rated boxes in rated walls or putty packs.)
- 4; provide positive connection of top plates to beam at rear on unit.
- 5; complete drywall at floor joist required for mechanical at rated ceiling.
- 6; complete mstc strap at shear wall.
- 7; test failed on D.W.W., supply approved.
- 8; complete firestop at party wall.

unit 201

- 1; complete nail plate at sprinkler.
- 2; test failed on d.w.v., supply approved.
- 3; no back to back electrical boxes at rated walls, (provide rated boxes in rated walls or putty packs.)
- 4; complete framing of closet.
- 5; electrical box in attic will be cover with insulation.
- 6; fix mstc strap at shearwall in garage.
- 7; complete fire blocking at stair landing.
- 8; tighten nut on hold downs in garage.
- 9; complete firestop at party wall.

unit 202

- 1; no back to back electrical boxes at rated walls, (provide rated boxes in rated walls or putty packs.)
- 2; tighten nuts on hold downs.
- complete anchor bolt in garage.
- 3; complete draft stop at stair landing.
- 4; test failed on D.W.W., supply approved.



Building Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

5 ;complete firestop at party wall.

6; no back to back electrical boxes at rated walls, (provide rated boxes in rated walls or putty packs.)

7; complete firestop at party wall.

unit 203

- 1; no back to back electrical boxes at rated walls, (provide rated boxes in rated walls or putty packs.)
- 2; tighten nut on hold downs.
- 3; complete firestop at party wall
- 4; complete fire blocking at stair landing.
- 5; complete anchor bolt in garage at party wall.
- 6; complete condensate drain line as discussed with Scott
- 7; test failed on D.W.W., supply approved.

unit 104

- 1; tighten nuts on hold downs.
- 2; no back to back electrical boxes at rated walls, (provide rated boxes in rated walls or putty packs.)
- 3 ;complete firestop at party wall.
- 4; complete duct seal at bathroom fans.
- 5; complete drywall at floor joist required for mechanical at rated ceiling,
- 6; provide positive connection of top plates to beam at rear on unit.
- 7; test failed on D.W.W., supply approved.

not a complete inspection, provide unit number prior to next inspection

Sincerely,

Shannon King Building Inspector 2

ShannonK@PuyallupWA.gov



Building Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

(253) 840-6684