City of Puyallup

Engineering Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

INSPECTION REPORT

Date of Inspection: Dec 17, 2024 Inspection Result: FAILED

Permit Number: PRGR20240491

Property Address: 3112 E PIONEER, PUYALLUP, WA 98372; 911 SHAW RD, PUYALLUP, WA

98372; 901 SHAW RD, PUYALLUP, WA 98372; 813 SHAW RD, PUYALLUP,

WA 98372;

Contractor: MCKEE ENTERPRISES, LLC PO BOX 5 ENUMCLAW, WA 98022

To construct: Grading for relocation and restoration of an existing stream at the East

Town Crossing site. STREAM RELOCATION - EAST TOWN CROSSING

On this day we have inspected your construction for **Erosion And Sediment Inspection** and we find the following result of the inspection. If there are any questions, please contact the inspector below.

Comments: * Suggestions and highly recommendations only.

The silt fence along the east side of the entrance is allowing silty runoff into the stream. The silt fence "should" be moved up hill 4-5' (top of slope or better) and armored between the stream and silt fence. The area filled along the east side has silty runoff in two areas beyond the silt fence into the stream. I highly "recommend" a diversion trench sloped away from the silt fence.

The temp pond has a low area (SE) along the stream side. A "suggestion" is to raise the berm to match the rest.

Note: See correction #1 below.

Thank You

Corrections:

- 1 1. Stop silty water from leaching to the stream past the silt fence in three areas.
 - Maintain ONSITE pavement cleanliness. No silt runoff into the storm.
 - Maintain silt fence.


Sincerely,



City of Puyallup

Engineering Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

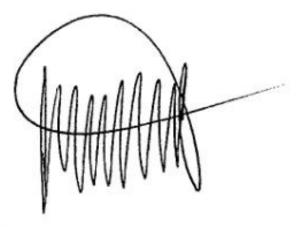

Jason Little
Development Engineering Inspector
JLittle@PuyallupWA.gov
(253) 244-0387