City of Puyallup

Engineering Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

INSPECTION REPORT

Date of Inspection: Apr 10, 2023 Inspection Result: FAILED

Permit Number: E-21-0313

Property Address: 1015 39TH AVE SE, PUYALLUP, WA 98374;

Contractor: DP EXCAVATION 11410 316th st e GRAHAM, WA 98338 (253) 720-

7790DP EXCAVATION 11410 316th st e GRAHAM, WA 98338 (253)

720-7790

To construct: PARKING LOT EXPANSION W. 675 STALLS, CFG~SHB-TC PARKING

EXPANSION/BENAROYA

On this day we have inspected your construction for **Erosion And Sediment Inspection** and we find the following result of the inspection. If there are any questions, please contact the inspector below.

Comments: Existing catch basin near MH3 needs to be cleaned. Straw waddles placed where there are no overlaps at low point. Sand bags added to straw waddles. Straw waddle added as secondary silt catch. Inlet protection added or cleaned.

Maybe add straw waddle around catch basin as well.

Corrections:

- 1 Maintain CESCL inspections and SWPPP on site.
 - Zero track out. Keep asphalt clean.
 - Dust on roadway is trackout.

(Possible solutions: begin with sweeper on site ALL day, wash tires, turn spalls at end of each day, install construction road around entire site, etc..) These are suggestions to help mitigate track out. In no way is the city dictating means and methods.

- May need to add a swale along the south side after cutting to grade.
- Protect slopes.


Sincerely,



City of Puyallup

Engineering Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

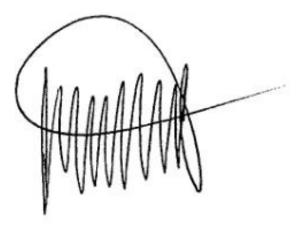

Jason Little Engineering Tech IV JLittle@PuyallupWA.gov (253) 435-3636