333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

INSPECTION REPORT

Date of Inspection: Jan 18, 2023 **Inspection Result: FAILED**

Permit Number: PRCCP20220770

Property Address: 1601 39TH AVE SE, PUYALLUP, WA 98374;

Contractor: ABSHER CONSTRUCTION CO PO BOX 280 PUYALLUP, WA 98371-0152

Raygan Kettman 1001 SHAW RD E PUYALLUP, WA 98372

To construct: The project proposes a new STEM classroom and laboratory building

> and a new parking lot, net gain of 100 stalls. Improvements include asphalt paving, concrete paving, a new building, utilities services for the new building, and stormwater management. Utility services include domestic water and water main, sewer main and services, natural gas, primary and secondary power, and telecommunications. Modifications to the existing parking lot east of the building and sidewalks adjacent to

the building will occur. A belowground detention facility utilizing Stormtech MC-7200 chambers are proposed for stormwater flow control. A bioretention facility will be used upstream of the proposed flow control facility to provide stormwater quality treatment for pollution

generating impervious surfaces (PGIS).

On this day we have inspected your construction for Erosion And Sediment Inspection and we find the following result of the inspection. If there are any questions, please contact the inspector below.

Comments: Illicit Discharge due to rain

- Trucks backing on site to dump are tracking silt out to the parking area and through the road way into unprotected CB's.
- Crew has a sweeper sweeping and spreading the silt to the edge only.
- Crew set straw wattles with sand bags to weigh them down.
- Crew installed CB socks.
- * I highly recommend staying off the imported bank run.
- * I highly recommend a sweeper with a vacuum.

Contractor needs to locate storm outlet to see if the illicit discharge made it's way to the filter system, pond, or direct discharge to the wetlands located east of the project.

OF PUYALLES OF WASHINGS

City of Puyallup


Engineering Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

Corrections:

- 1 Maintain silt run off on site.
 - Zero track out. This needs to be cleaned up at time of track out.
 - Locate illicit discharge outlet after entering the catch basins.

Sincerely,

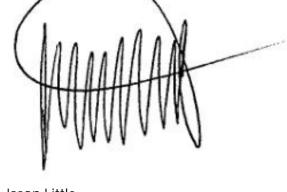

Jason Little Engineering Tech IV JLittle@PuyallupWA.gov (253) 435-3636