

SCALE: NONE


SCALE: NONE

P01: INST 2 - 3" RISERS ON STANDOFF BRKTS REMOVE CUSTOMER RISERS


3-22 / (2)3-4 HH1: INST 6' x 4', 644 SECONDARY HH W/ 8 POS CONN BARS INST LID GROUND REDIRECT EXISTING CUSTOMER SVC WIRE TO HH CONNECT & TAG CUSTOMER RAN UG SVC LINES (1 RUN OF 600KCM)


(2)3-6 P01 TO HH1: INST 2 - 3" DB120 PSE PROVIDED CONDUIT ±10FT INST 2 - 350 QUAD ±55FT (ACTUAL:___

CUSTOMER NOTES: SITE MUST BE READY 1 WEEK PRIOR TO CONSTRUCTION. CUSTOMER TO PROVIDE ALL TRENCHING AND EXCAVATING

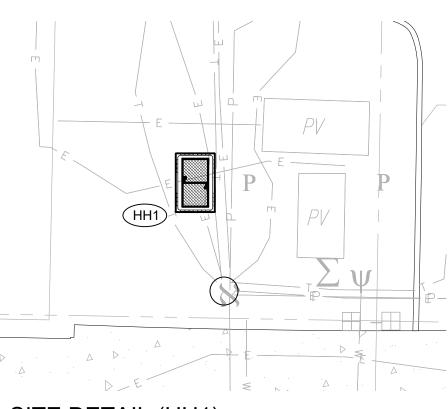

SITE DETAIL (HH1) SCALE: 1" = 10'

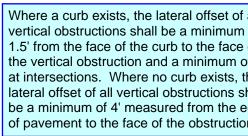

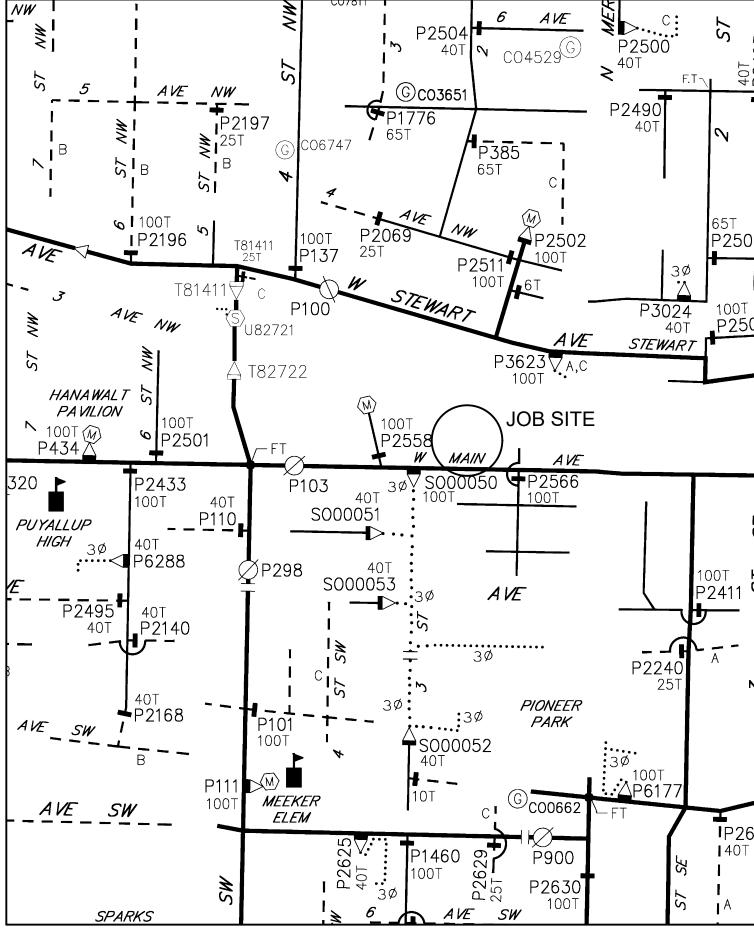

OVERHEAD CIRCUIT MAP SCALE: NONE

POWER GENERAL NOTES - COMMERCIAL PROJECT

- 1. All materials to be installed in accordance with Puget Sound Energy's (PSE) standards. Any deviation from this work sketch must be AUTHORIZED by PSE's Project Manager and NOTED on the Foremans' Copy.
- 2. All switching arrangements and/or outage arrangements are to be made with the Project Manager at least three (3) working days in advance.
- 3. Contact the Utilities Underground Location Center (1-800-424-5555) at least 48 hours prior to commencing work to get the underground facilities located.
- 4. STAKING: The customer will provide all staking (transformer, handhole, trench, grade, lot, pole, sidewalk, etc.). See sketch and details for locations. Equipment locations must be approved by the Project Manager.
- 5. SITE PREPARATION: The work area will be at or near finished grade, clear of trench spoils or construction materials which would restrict construction and/or equipment access, before work can begin.
- 6. Roads shall be paved or have a compacted , crushed rock base in place.
- 7. CLEARANCES: Transformers require a minimum of 6 feet from fire fighting equipment, 10 feet from combustible walls, overhangs, doors, and windows, and a minimum of 5 feet from the back of curb (or guard posts will be required per PSE standards). All conduits and vaults are to be at least 5 feet away from water, storm and sewer lines when paralleling them in the right of way, and at least 1 foot when crossing them.
- 8. All work is to be done in accordance with local municipal and county permit requirements as applicable.
- 9. Customer/Developer is responsible to provide, install and maintain all secondary service cables, conduits and crossings from the individual unit's meter base to the designated connection point.
- 10. Inclement weather conditions may cause delays in construction times and dates.
- 11. EXCAVATION: The customer is to provide all trenching, backfill, vault excavations, compaction and restoration per this sketch and per PSE standards. A minimum protective cover of 36" is required over PSE's primary voltage equipment and 24" is required of PSE's secondary voltage equipment. The customer will provide any and all shoring or they will side slope the trench to 1:1.

CIRCUIT LOADING TABLE

Circuit: STW-16	Custome	er 3Ø Load:	11	
As Of: 2021	Po	wer Factor:	.85	
	Phase to Phase	se Voltage:	12500	
	<u>A Phase</u>	<u>B Phase</u>	<u>C Phase</u>	
Existing Peak Load:	278.0	288.0	270.0	
Estimated New Load:	0.6	0.6	0.6	
Total:	278.6	288.6	270.6	

ECOSION & SEDIMENT CONTROL REQUIREMENTS City of Puyallup Development 2 of Puyallup Puyallup Development 2 of Puyallup PuyallupPuyallup <tr< th=""><th>ARD PRACTICE ENT CONTROL NTS INCLUDING STRUCTURES PICAL EROSIO SITIVE AREAS</th><th>STANDAR SEDIMEN ENTS. JIREMENT CONTROL S THE TYPIC K IN SENS</th><th>ARY EROSION & S ION REQUIREMEND DITIONAL REQUI OR SEDIMENT CO ON DETAILS OF T ENTS FOR WORK</th><th>NTROL SHALL DR TEMPORAL JURISDICTIO AY HAVE ADD EROSION OF COSS SECTION REQUIREMEN</th><th>ION & SEDIMENT 3200 TECHNIQUES ADDITIONAL LOG A JURISDICTIONS S DETAILING WH O BE INSTALLED CTURES, & SPEC PLETED) SLEAN/SAFE Condition.</th><th>HEN CO</th><th>orks c 3OX <u>ED</u> & V NSTAL puilt. notec -built.</th><th>mitting Se ERMIT Plannin Public W Traffi (CHECK E</th><th>ent & Per SUED P Ing ering</th><th>evelopme IS Buildir Enginee Fire</th></tr<>	ARD PRACTICE ENT CONTROL NTS INCLUDING STRUCTURES PICAL EROSIO SITIVE AREAS	STANDAR SEDIMEN ENTS. JIREMENT CONTROL S THE TYPIC K IN SENS	ARY EROSION & S ION REQUIREMEND DITIONAL REQUI OR SEDIMENT CO ON DETAILS OF T ENTS FOR WORK	NTROL SHALL DR TEMPORAL JURISDICTIO AY HAVE ADD EROSION OF COSS SECTION REQUIREMEN	ION & SEDIMENT 3200 TECHNIQUES ADDITIONAL LOG A JURISDICTIONS S DETAILING WH O BE INSTALLED CTURES, & SPEC PLETED) SLEAN/SAFE Condition.	HEN CO	orks c 3OX <u>ED</u> & V NSTAL puilt. notec -built.	mitting Se ERMIT Plannin Public W Traffi (CHECK E	ent & Per SUED P Ing ering	evelopme IS Buildir Enginee Fire
City of Puyaliup Development & Permiting Services ISSUED Previous Market ADDITIONAL REQUIREMENTS. ILOCAL JURISDICTION RESISTOR SEDIMENT CONTROL STRU Development & Permiting Services ISSUED Previous Market ADDITIONAL REQUIREMENTS FOR WORK IN SENSITIVE STRUCTURES, & SPECIAL REQUIREMENTS STRUCTURES, & SPECIAL REQUIREMENT, MORENTS STRUCTURES, & SPECIAL REQUIR	ENT CONTROL NTS INCLUDING STRUCTURES PICAL EROSIO SITIVE AREAS SITIVE AREAS SITI	SEDIMEN ENTS. JIREMENT CONTROL S THE TYPIC K IN SENS	ARY EROSION & S ION REQUIREMEND DITIONAL REQUI OR SEDIMENT CO ON DETAILS OF T ENTS FOR WORK	DR TEMPORAH JURISDICTIO AY HAVE ADD EROSION OF COSS SECTION REQUIREMEN	2200 TECHNIQUES ADDITIONAL LOO AL JURISDICTIONS S DETAILING WH O BE INSTALLED CTURES, & SPEC PLETED) CLEAN/SAFE Condition.	HEN CO	orks c 3OX <u>ED</u> & V NSTAL puilt. notec -built.	mitting Se ERMIT Plannin Public W Traffi (CHECK E	ent & Per SUED P Ing ering	evelopme IS Buildir Enginee Fire
Development & Permitting Services ISSUED PERMIT Building Planning P	ASITIVE AREAS	K IN SENS		REQUIREMEN	CTURES, & SPEC PLETED) CLEAN/SAFE Condition. C. HASE. d procedures	HEN CO Area left in D & VERIFI Paperwork on on As-bu RIFY prope son.	orks c 3OX <u>ED</u> & V NSTAL puilt. notec -built.	mitting Se ERMIT Plannin Public W Traffi (CHECK E	ent & Per SUED P Ing ering	evelopme IS Buildir Enginee Fire
Building Planning Engineering Public Works Fire Traffic Post Equipment LockSDBECURED & Work Area let in CLENISAE Condition Optication Statute Da VERIPED Optication and Switch multicable XERIPED Optication Statute Da VERIPED Optication and Switch multicable XERIPED Optication Statute Da VERIPED Deviations noted on the Arbuilt and their reason: Optication Statute Date Statute Dat	N N N N N N S BEFORE YOU D N N OF EXISTING FACILIT YES N N VIA N/A N/A 441.6244 4/13/23 4/13/23 1/A N/A N/A			W PIONEER	CLEAN/SAFE Condition.	Area left in <u>0 & VERIFI</u> Paperwork on on As-bu <u>RIFY</u> prope son.	C C BOX <u>ED</u> & V NSTAL puilt. i notec -built.	Plannin Public W Traffi (CHECK E	ering	Buildir Enginee Fire
Fire Formula Fire FOREMAN (CHECK BOX WHEN COMPLETED) Order, Cable, and Switch numbers INSTALED & VERIFIED Ford Chable, and Switch numbers INSTALED & VERIFIED Field Change RED-LikeD on Cablutt Material VERIFIED and CHANGES noted on Paperook. Company UMF RECOMED in comed footume on As-built Company UMF RECOMED in comed footume on As-built Deviations noted on the Ad-built and their reason: Will CONECT FHASE Print Name Date Prome Transport Signature Print Name Date Prome Status Signature Print Name Date	N N N N N N S BEFORE YOU D N N OF EXISTING FACILIT YES N N VIA N/A N/A 441.6244 4/13/23 4/13/23 1/A N/A N/A			W PIONEER	CLEAN/SAFE Condition.	Area left in <u>0 & VERIFI</u> Paperwork on on As-bu <u>RIFY</u> prope son.	C BOX <u>ED</u> & V NSTAL puilt. i notec -built.	Traffi (CHECK E	E OF V	Fire
FOREMAN (CHECK BOX WHEN COMPLETED) PSE Equipment LOCKEDISECURED & Work Area latin (CLEANSAFE Condition Grint, Cale, and South numbers INSTALLED & VERIFED. Output: Company Date Standards and procedures and that all quality requirements are met. Deviations noted on the A-built & CERNISARE Deviations noted on the A-built & CERNISARE Print Name Project PHASE Num Removal Deviations NNA Service Studes NNA HP SvcMSA NNA CABLE TV HENNE ENVIRE Deviations NNA HP SvcMSA NNA NA HP SvcMSA NNA NA ENVIRE Deviations NNA HP SvcMSA NNA NA HP SvcMSA NNA NA HP SvcMSA NNA NA HP SvcMSA NNA ENVIRE Deviations NNA HP SvcMSA NNA NA HP SvcMSA NNA NA HP SvcMSA NNA HP Svc	N N N N N N S BEFORE YOU D N N OF EXISTING FACILIT YES N N VIA N/A N/A 441.6244 4/13/23 4/13/23 1/A N/A N/A			W PIONEER	CLEAN/SAFE Condition.	Area left in <u>0 & VERIFI</u> Paperwork on on As-bu <u>RIFY</u> prope son.	3OX ED & V NSTAL puilt. notec -built.		AL NO	
BSE Equipment LOCEEDSEQUEED & Work Area left in CLEANSAFE Condition BSE Equipment LOCUEEDSEQUEED & Work Area left in CLEANSAFE Condition Bit of hanges BEELINED on Actual Company UBFIED and CHARGES noted on Pachwitz Company UBFIED and CHARGES noted on Actual Company UBFIED and CHARGES noted on Actual Company UBFIED and CHARGES noted on Actual Company UBF RECORCED with and their requirements are not. Protein and that al quality requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on the Actual and their requirements are not. Promemonic on theire and theire algost and and proceedures and and procedu	N N N N N N S BEFORE YOU D N N OF EXISTING FACILIT YES N N VIA N/A N/A 441.6244 4/13/23 4/13/23 1/A N/A N/A			W PIONEER	CLEAN/SAFE Condition.	Area left in <u>0 & VERIFI</u> Paperwork on on As-bu <u>RIFY</u> prope son.	ED & V NSTAL puilt. notec -built.	CKED/SECURE	OREMAN	
Grd, Case, and Switch numbers INSTALED & VERIFIED Field Changes RED.LINED on As-built Grd, Case, and Switch numbers loss on As-built Grd, Case, and Switch numbers INSTALED & VERIFY Grd, Case, and Switch numbers loss on As-built Grd, Case, and Switch numbers Grd, Case, and Matal Nampers Grd, Case, and Matanger <	N N N N N N S BEFORE YOU D N N OF EXISTING FACILIT YES N N VIA N/A N/A 441.6244 4/13/23 4/13/23 1/A N/A N/A			W PIONEER	<u>HASE</u> . d procedures	D & VERIFI Paperwork on on As-bu <u>RIFY</u> prope son.	NSTAL puilt. notec -built.			F(
Bield Changes RED_INED on A-Built. Company MARKET State noted on Pagework. Company DNB RECORDED in correct rectation on A-shult. Company DNB RECORDED Not and their reson. Deviations noted on the A-built. Deviations noted on the A-built. Deviations noted on the A-built. Deviations noted on the A-built. Deviations noted on the A-built. Deviations noted on the A-built. Print Name Date Date Date Date Date Date Stitub Date Date Stitub Date Propertor Stath Stath Date Stath Stath NA Datagere Date	N N N N N N S BEFORE YOU D N N OF EXISTING FACILIT YES N N VIA N/A N/A 441.6244 4/13/23 4/13/23 1/A N/A N/A			W PIONEER	- HASE. d procedures	Paperwork on on As-bu <u>RIFY</u> prope son.	ouilt. notec -built.	itch numbers II		
□ Company Diffs RECORDED normed location on As-built. □ Company Diffs RECORDED normed location on As-built. □ Indicate correct FUES SIZE on As-built. □ Lerithy that the work performed meets PSE's standards and procedures and that all quality requirements are met. Promemar's Signature	SITE SITE SITE			W PIONEER	d procedures	on on As-bu <u>RIFY</u> prope son.	- -built.	<u>-LINED</u> on As-I	Changes <u>RED</u>	Field C
Indicate correct FLIGE SIZE on As-built & VERIPY proper PHASE. Deviations noted on the As-built and their reason. I centry that the work performed meets PSE's standards and procedures and that all quality requirements are met. Print Name Deviations noted on the As-built and their reason. Print Name Date Print Name Date Print Name Date Strint Removal Job Order NAA NAA NAA Project Maager Contact Information: Marger Lonnie Adams Cell Prone: 253 M41 6244 E-Mail: Contacts Information: Marger Required YES Saging Required YES PHONE ND DANIE CakIN 425-466-2216	SITE SITE SITE	JQB		W PIONEER	d procedures	<u>RIFY</u> prope son.	rect lo	ole noted on As	PRIMARY Cat	Total P
I certify that the work performed meets PSE's standards and procedures and that all quality requirements are met. Image: Contract information: Project PHASE NOTIF# ORDER# PWR Superior 513332663 105103016 VE SW Ve SW Ve Print Name Date Date Ve SW Ve SW PWR Superior 513332663 105103016 Ve SW	SITE Coordinate SITE Coordinate SITE Coordinate SITE Coordinate Info Coordinate 177 office Coordinate Info Coordinate	J <u>J</u> A:		W PIONEER	·		built &	E SIZE on As-	te correct FUS	Indicate
and that all quality requirements are met. Foreman's Signature Print Name Date Project Phase NOTIF# ORDER# PWR Superior S13332663 S13332663 S13332663 S105103018 SVE S13332663 S1513322663 S105103018 SVE S13332663 S105103018 SVE S13332663 S105103018 VE SW	SITE Coordinate SITE Coordinate SITE Coordinate SITE Coordinate Info Coordinate 177 office Coordinate Info Coordinate	J <u>J</u> A:		W PIONEER	·	standards	d their	the As-built an	tions noted on	Deviation Deviation
and that all quality requirements are met. Foreman's Signature Print Name	SITE Coordinate SITE Coordinate SITE Coordinate SITE Coordinate Info Coordinate 177 office Coordinate Info Coordinate	J <u>J</u> A:					ets P	c performed me	fy that the work	I certify
Foreman's Signature Date Print Name Date Print Name Date PROJECT PHASE NOTIF# PWR Superior Superior 513332663 Pole Re VE AVE SW Pole Re VE AVE SW Job Order NA Perm. Service 514084001 Obd Order NA Service Stubs NA H AVE Project Manager Contact Information: Manager: Lonnie Adams Cell Phone: 253.841.6244 E-Mail: Lonnie Adams @pse.com PSE Locates Required YES Outages Required YES Tels SketTCH NOT To be RELIED UPON FOR EXACT LOCATION OF EXIST Quady YES Tels SketCH NOT To be RELIED UPON FOR EXACT LOCATION OF EXIST Signing Required YES 3 FUNCTION CONTACT PHONE NO 22 DATE BY DESCRIPTION	A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A	J <u>J</u> A:					e met.	equirements are	iat all quality re	and tha
Print Name Date PROJECT PHASE NOTIF# ORDER# PWR Superior 513332663 105103018 VE SW VE SW Job Order Service 514084001 104352932 Job Order N/A N/A Perm. Service 514084001 104352932 Job Order N/A N/A Project Manager N/A N/A Phone N/A N/A Project Manager Lonnie Adams Quence / Developer Contact Information: Manager Lonnie Adams Quence / Developer Contact Dev	A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A		AVE SW	5TH A					Signature	Foreman's S
PROJECT PHASE NOTIF# ORDER# PWR Superior 51332663 105103018 YE Signature Statulation Statulation Job Order N/A N/A N/A Perens. Service 514084001 104352932 TH Ave SW Job Order N/A N/A N/A N/A Perens. Service Stubs N/A N/A N/A MR 2004001 104352932 Community Health Care Community Health Care PHONE Community Health Care 1148 Broadway, Suite 100 Tacoma, WA 89402 Project Manager Contact Information: Manager Constact Adams Cable TV Cell Prone: 253.841 6244 For contacts below dial 1-888-CALL PSE (225-5773) CALL 811 TWO BUSINESS DAYS BEFOR PSE Locates Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST PERMIT Pagaing Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST PERMIT Pagaing Required YES State 16244 ENGR - POWER DANIEL GAKIN 425-466-2218 Culages Required YES State	A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A		AVE SW	5TH A						
PROJECT PHASE NOTIF# ORDER# PWR Superior 513332663 105103018 Pole Re VE SW Image: Control for the second se	A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A A		AVE SW	<u> </u>						Print Name
PWR Superior 513332663 105103018 Poie Re	Image: Application of the system Image	Σ						NOTIE#		
Xfrmr Removal Job Order Image: Service 514084001 Image: Service 514084001 Image: Service 514084001 Image: Service 704 Image: Service 704 </td <td>177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>3</td> <td></td> <td></td> <td></td>	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2						3			
Job Order Struce 514084001 104352932 Job Order N/A N/A GAS Distribution N/A N/A Service Stubs N/A N/A HP Svc/MSA N/A N/A CABLE TV Owner / Developer Contact Information: Project Manager Contact Information: Manager Contact Information: Manager Contact Information: Call Phone: 253.841.6244 E-Mail: Lonnie Adams Cell Phone: Stat.6244 E-Mail: Lonnie Adams Outages Required YES Outages Required YES Outages Required YES 3 CALL 811 TWO BUSINESS DAYS BEFOR Could all 1-888-CALL PSE (225-5773) PERMIT Elassing Required YES 3 CALL 811 TWO BUSINESS DAYS BEFOR 7 FUNCTION CONTACT PHONE NO PROJECT MGR L.Adams 2 Project MGR L.Adams 3 EngR - POWER DANIEL GAKIN 425-466-2218 REV# DATE BY DESCRIPTION ENGR - GAS COUNTY Emer Sect Gas Wk Ctr	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2	S		SW						
Perm. Service Job Order 514084001 104352932 N/A TH A VE SW GAS Distribution N/A N/A N/A N/A Service Stubs HP Svc/MSA N/A N/A N/A HP Svc/MSA N/A N/A N/A PHONE	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2									
Job Order N/A N/A N/A GAS Distribution N/A N/A N/A Service Stubs N/A N/A N/A HP Svc/MSA N/A N/A N/A CABLE TV	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2		SW/		104352932		1	51408400		
Service Stubs N/A N/A HP Svc/MSA N/A N/A CABLE TV PHONE Project Manager Contact Information: Manager: Lonnie Adams 206-634-0177 office Cell Phone: 253.841.6244 E-Mail: Lonnie.Adams @pse.com For contacts below dial 1-888-CALL PSE (225-5773) PSE Locates Required YES CALL 811 TWO BUSINESS DAYS BEFOR Outages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Outages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Outages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Outages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Quadages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Quadages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST QUAges Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST QUAlges Required YES THIS SKETCH NOT TO BE	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2		<u></u>	AVE S						
HP Svc/MSA N/A N/A CABLE TV Owner / Developer Contact Info PHONE Community Health Care 1148 Broadway, Suite 100 Manager: Lonnie Adams 206-634-0177 office Cell Phone: 253.841.6244 Second For contacts below dial 1-888-CALL PSE (225-5773) PSE Locates Required NO CALL 811 TWO BUSINESS DAYS BEFOR Outages Required YES For contacts below dial 1-888-CALL PSE (225-5773) REAL ESTATE/EASEMENT PERMIT Igaging Required YES YES 3 Occontacts below dial 1-888-CALL PSE (225-5773) 2 VIA YES 3 PERMIT PERMIT 12 YES For contacts below dial 1-888-CALL PSE (225-5773) 3 VES SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST 118 SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST YES 3 VES FOR CONTACT PHONE NO 2 VES FOR - POWER DANIEL GAKIN 425-466-2218 14 Emer Sect Gas Wk Ctr POWER WK CTR DRAWN BY DANIEL GAKIN 425-466-2218	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2	71			N/A					
CABLE TV Owner / Developer Contact Info Project Manager Contact Information: Community Health Care Manager: Lonnie Adams Community Health Care Cell Phone: 253.841.6244 Community Health Care E-Mail: Lonnie Adams @pse.com For contacts below dial 1-888-CALL PSE (225-5773) PSE Locates Required NO CALL 811 TWO BUSINESS DAYS BEFOR Customer Locates Required YES For contacts below dial 1-888-CALL PSE (225-5773) Outages Required YES Function of exact location of existing of the sector of the s	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2			>						
PHONE Image: Image: Community Health Care Project Manager Contact Information: Sample Contact Information: Community Health Care 1148 Broadway, Suite 100 Manager: Lonnie Adams Coll Phone: 253.841.6244 206-634-0177 office E-Mail: Lonnie Adams @pse.com For contacts below dial 1-888-CALL PSE (225-5773) For contacts below dial 1-888-CALL PSE (225-5773) PSE Locates Required YES For contacts below dial 1-888-CALL PSE (225-5773) Outages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Outages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Sagen Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Sagen Required YES Flagging Required YES Sagen Required YES FUNCTION CONTACT PHONE NO 2 Imagen VES FUNCTION CONTACT PHONE NO 2 Imagen VES FUNCTION CONTACT PHONE NO 2 Imagen VES FOR GAS N/A N/A 2 Imagen DATE BY	177 office) S BEFORE YOU D N OF EXISTING FACILIT YES NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 1/A N/A 466-2218 4/13/2	ntact Infr)eveloper Cont	Owner / De	N/A			N/A		
Community Health Care 1148 Broadway, Suite 100 Tacoma, WA 98402 ATTN: Ilen Hagen Manager: Lonnie Adams Cell Phone: 253.841.6244 E-Mail: Lonnie Adams @pse.com For contacts below dial 1-888-CALL PSE (225-5773) CALL 811 TWO BUSINESS DAYS BEFOR Customer Locates Required YES Outages Required YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST Outages Required YES SUBJECTION COMMER Constant PROJECT MGR L.Adams 253.841.6244 PROJECT MGR L.Adams OUTAGE NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST OUTAGE NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST OUTAGE NEW YES THIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST OUTAGE NEW YES SUBSCRIPTION ENGR - POWER DATE BY DESCRIPTION ENGR - GAS N/A N/A N/A N/A	YES Neno Date 441.6244 4/13/23 466-2218 4/13/23 466-2218 4/13/23		-							
Project wanager Contact information: Tacoma, WA 98402 ATTN: Ilen Hagen 206-634-0177 office Cell Phone: 253.841.6244 E-Mail: Lonnie.Adams @pse.com CALL 811 TWO BUSINESS DAYS BEFOR Outages Required YES CALL 811 TWO BUSINESS DAYS BEFOR Outages Required YES CALL STATE/EASEMENT PERMIT YES State Sequired YES Flagging Required YES State Sequired YES PROJECT MGR L.Adams 253.841.624 <tr< td=""><td>YES Neno Date 441.6244 4/13/23 466-2218 4/13/23 466-2218 4/13/23</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr<>	YES Neno Date 441.6244 4/13/23 466-2218 4/13/23 466-2218 4/13/23									
Cell Phone: 253.841.6244 E-Mail: Lonnie.Adams @pse.com PSE Locates Required NO Customer Locates Required YES Outages Required YES Flagging Required YES 1 YES 2 Image: Provide the section of the section	YES Neno Date 441.6244 4/13/23 466-2218 4/13/23 466-2218 4/13/23	000 004 0477	3402	Tacoma, WA 9840			1:		•	-
For contacts below dial 1-888-CALL PSE (225-5773) CALL 811 TWO BUSINESS DAYS BEFOR Customer Locates Required YES Outages Required YES YES Flagging Required YES YES REAL ESTATE/EASEMENT PERMIT EASEMENT YES 3 CONTACT PHONE NO 2 Image: Provide the state of the sta	YES N OF EXISTING FACILIT YES NE NO DATE 441.6244 4/13/23 466-2218 4/13/23 1/A N/A 466-2218 4/13/23	206-634-0177	en 20	ATTN: lien Hagen						
PSE Locates Required NO Customer Locates Required YES Outages Required YES Flagging Required YES 73 YES 3 Constant 2 Prese 1	YES NE NO DATE 41.6244 4/13/23 466-2218 4/13/23 1/A N/A 466-2218 4/13/23	(225-5773)	lial 1-888-CALL PSE (2	ontacts below dial			ı			
Customer Locates RequiredYES YESTHIS SKETCH NOT TO BE RELIED UPON FOR EXACT LOCATION OF EXIST PERMIT EASEMENTPERMIT YES3Image: State of the st	YES NE NO DATE 141.6244 4/13/2: 466-2218 4/13/2: 1/A N/A 466-2218 4/13/2:	ESS DAYS E	LL 811 TWO BUSINE	CALL					s Poquirod	DSE Locator
$\begin{array}{c c c c c c c c c c c c c c c c c c c $	YES NE NO DATE 141.6244 4/13/2: 466-2218 4/13/2: 1/A N/A 466-2218 4/13/2:		E RELIED LIPON FOR EXACT							
Flagging RequiredYESYESEASEMENTYES30Image: Second Sec	YES NE NO DATE 441.6244 4/13/23 466-2218 4/13/23 I/A N/A 466-2218 4/13/23								•	
3 Image: Section of the se	NE NO DATE 141.6244 4/13/2 466-2218 4/13/2 I/A N/A 466-2218 4/13/2						S	YE	quired	Flagging Req
2 Image: Marking the section of the secti	41.6244 4/13/23 466-2218 4/13/23 I/A N/A 466-2218 4/13/23	PHONE								3
REV# DATE BY DESCRIPTION ENGR - GAS N/A N/A COUNTY Emer Sect Gas Wk Ctr POWER WK CTR DRAWN BY DANIEL GAKIN 425-466-2218 PIERCE N/A N/A QSWPRE CHECKED BY J. WELCH 1/4 SEC OP MAP PLAT MAP APPROVED BY Nate Linville (253) 970-7284 SE¼, Sect28, T20, R04E N/A UG CKT MAP CIRCUIT NO FOREMAN #1 U-MAP NO (POWER) OH CKT MAP UG CKT MAP CIRCUIT NO FOREMAN #2 2004E112 2004E112 STW-16 MAPPING	466-2218 4/13/2 J/A N/A 466-2218 4/13/2						1			
COUNTY Emer Sect Gas Wk Ctr POWER WK CTR DRAWN BY DANIEL GAKIN 425-466-2218 PIERCE N/A N/A QSWPRE CHECKED BY J. WELCH 1/4 SEC OP MAP PLAT MAP APPROVED BY Nate Linville (253) 970-7284 SE¼,Sect28,T20,R04E N/A VIA N/A FOREMAN #1 (253) 970-7284 U-MAP NO (POWER) OH CKT MAP UG CKT MAP CIRCUIT NO FOREMAN #2 Image: Carcity of the sector of	466-2218 4/13/2	425-466	DANIEL GAKIN	R - POWER						1
$\begin{array}{c c c c c c c c c c c c c c c c c c c $		N/A	N/A	R - GAS			DES	BY	DATE	REV#
1/4 SEC OP MAP PLAT MAP APPROVED BY Nate Linville (253) 970-7284 SE¼,Sect28,T20,R04E N/A N/A FOREMAN #1 (253) 970-7284 U-MAP NO (POWER) OH CKT MAP UG CKT MAP CIRCUIT NO FOREMAN #2 (253) 970-7284 2004E112 2004E112 STW-16 MAPPING (253) 970-7284	1100100	425-466	DANIEL GAKIN	WN BY	ER WK CTR	Ctr PC	Gas	Emer Sect		COUNTY
SE¼,Sect28,T20,R04E N/A FOREMAN #1 Correction U-MAP NO (POWER) OH CKT MAP UG CKT MAP CIRCUIT NO FOREMAN #2 CIRCUIT NO 2004E112 2004E112 2004E112 STW-16 MAPPING CIRCUIT NO	4/26/23		J. WELCH	CKED BY	QSWPRE	۹ 🗌		N/A	RCE	PIEF
U-MAP NO (POWER) OH CKT MAP UG CKT MAP CIRCUIT NO FOREMAN #2 2004E112 2004E112 2004E112 STW-16 MAPPING	70-7284 05/24/2		Nate Linville	ROVED BY	MAP	PL		OP MAP		1/4 SEC
2004E112 2004E112 STW-16 MAPPING		(253) 970					-			
		(253) 970							. ,	•
JOINT FACILITIES ARRANGEMENTS		(253) 970					12	2004E1	1E112	2004
		(253) 970		GEMENTS	DINT FACILITIES ARI					
UTILITIES N/A N/A N/A N/A		(253) 970								
CONTACT N/A N/A N/A N/A		(253) 970 			N/A					
PHONE# N/A N/A N/A N/A		(253) 970 (253) 970	N/A				N/A		PHONE#	1
			N/A							
Gas Order E	-		N/A		N/A			FT		
		INCIDEN N/A	N/A	•	_{N/A} C Puyallup (CI			PUG	
EINERCY 111 W MAIN, PUYALLUP, 98371 SCALE	PAGE	INCIDEN N/A Gas Orde	N/A	L/E	N/A C Puyallup C COMMERCIAL 30	CI		ND	sou	PSE
PSE AS NOTED	IOTED 1/1	INCIDEN N/A Gas Orde N/A	N/A N/A	L/E	N/A C Puyallup C COMMERCIAL 30	CI		ND	sou	PSE