


Deck Repair

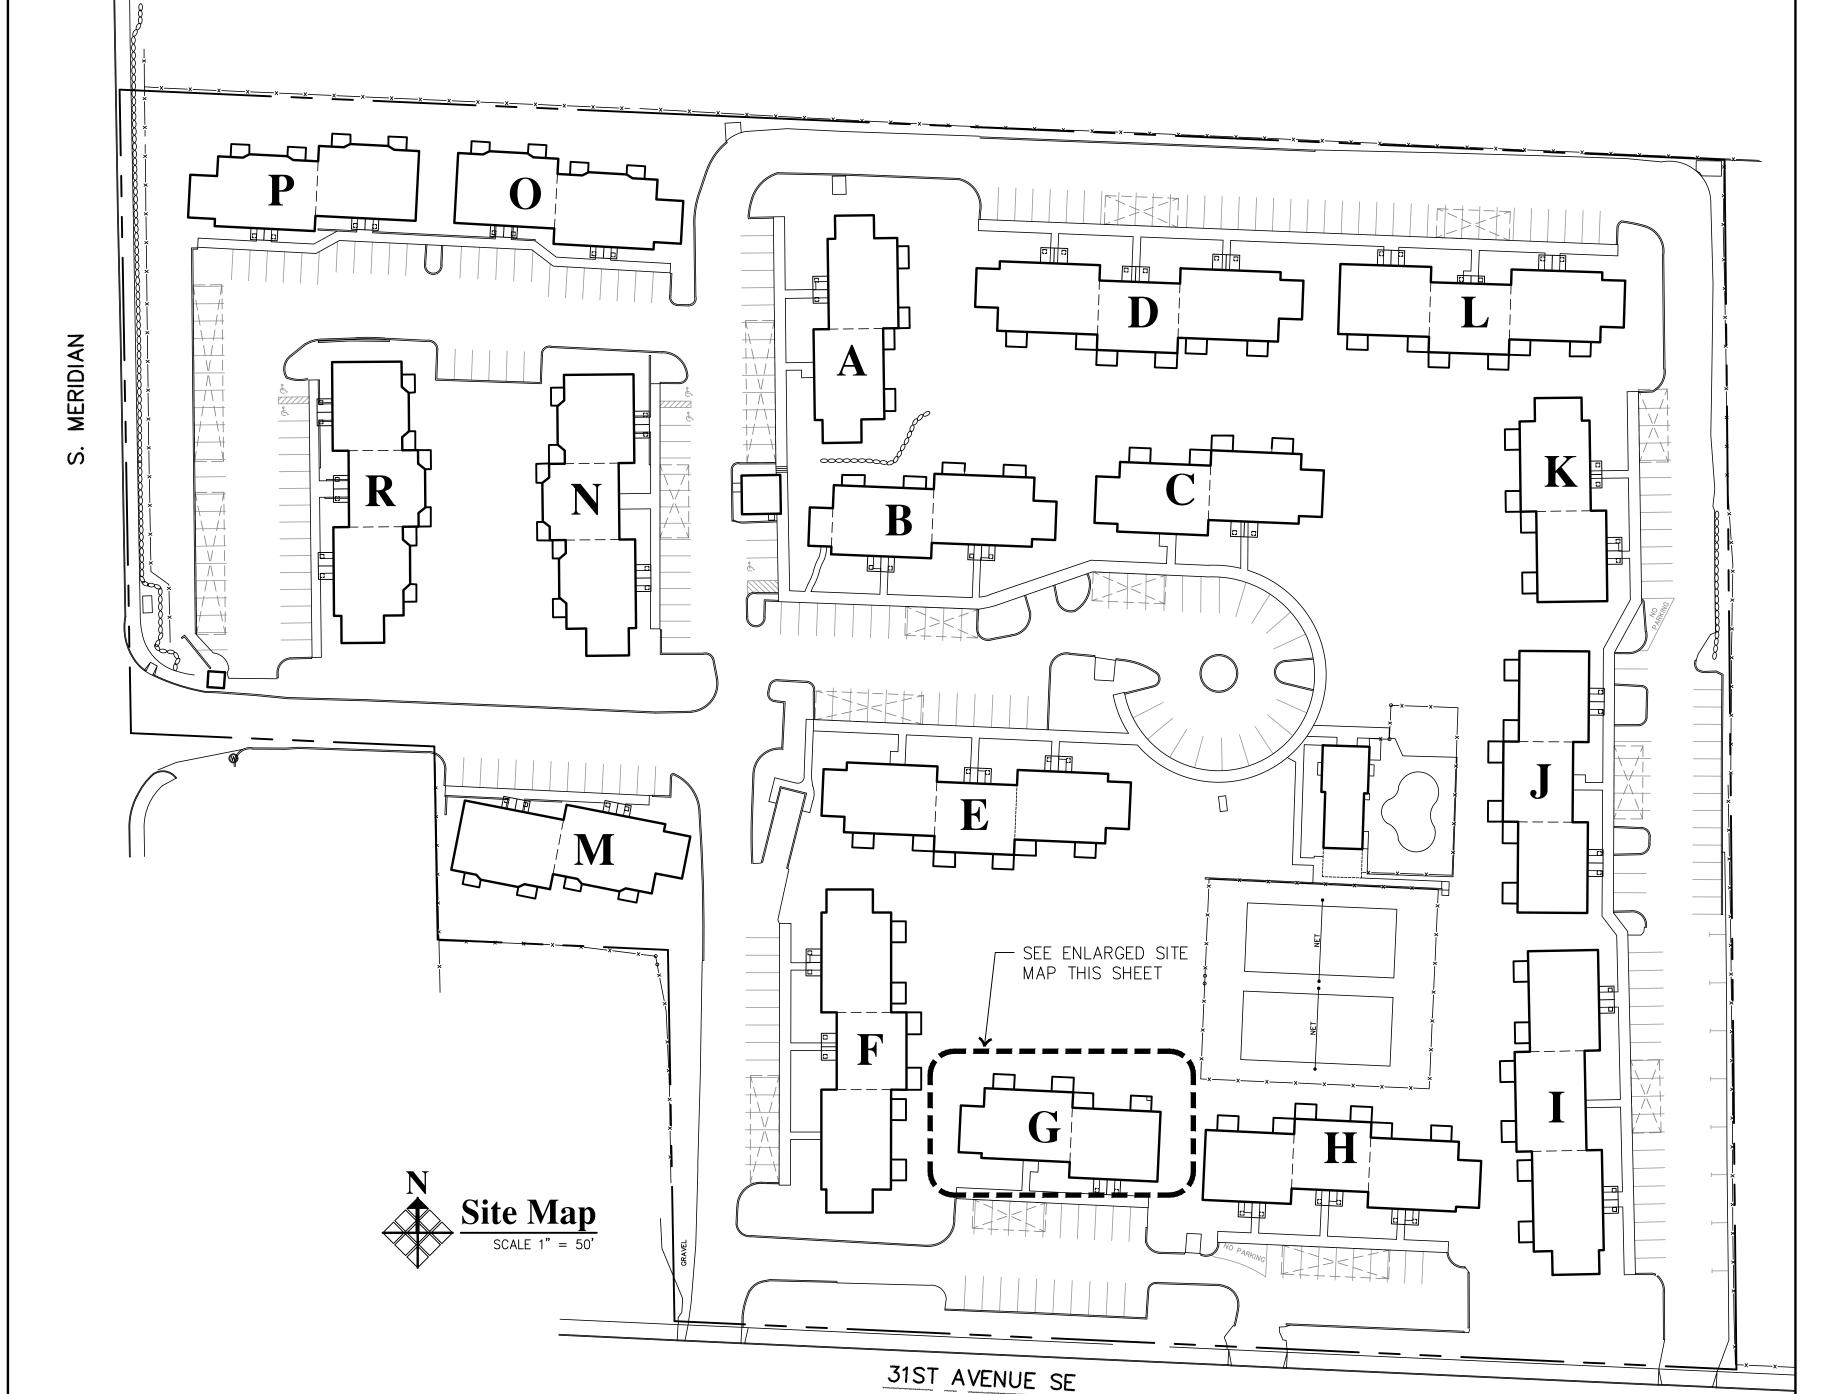

City of Puyallup

**Planning** 

Division **APPROVED** 

See permit


conditions.


**JHulseLew** 


12/30/2024

9:49:11 AM

**Project Statistics** CODE COMPLIANCE: 2021 INTERNATIONAL EXIST BLDG CODE 2923 S. MERIDIAN ST (BLDG G) SITE ADDRESS: PUYALLUP, WA 0419032096 R-2 OCCUPANCY MULTI-FAMILY 2 STORY APARTMENTS NUMBER OF DECKS: 4 DECKS

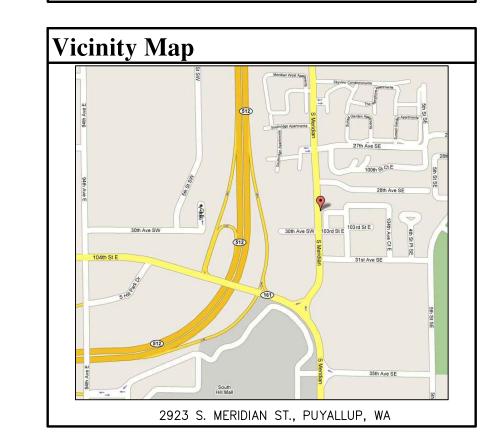

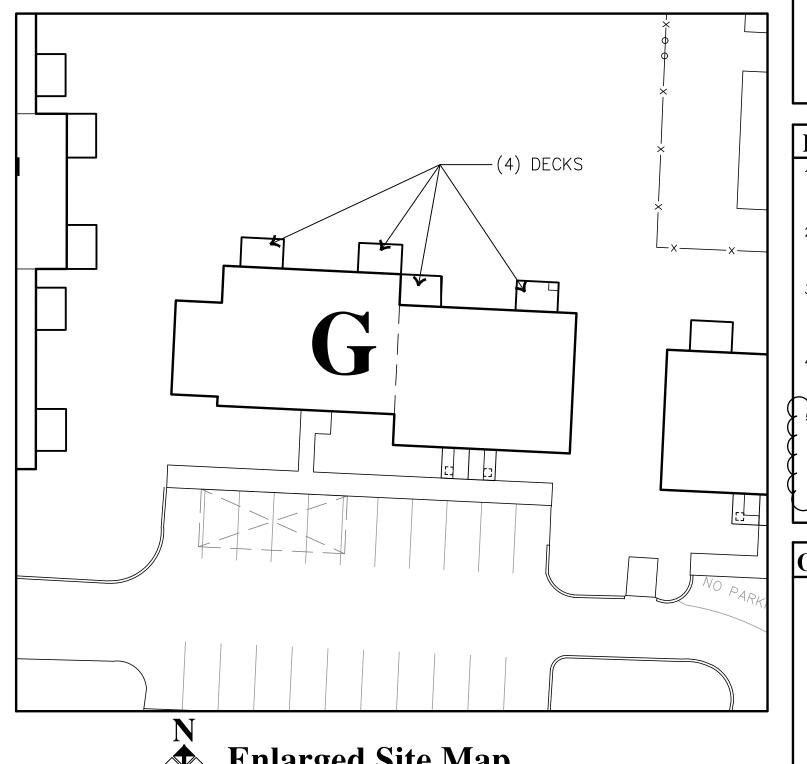



- DECKING REPLACEMENT COMPLETE - HORIZONTAL RAILING COMPLETE ON - RAILINGS NOT PAINTED - NO DECK REPAIR/REPLACEMENT OR CONSTRUCTION HAS BEEN STARTED **Photos of Existing Conditions** 

**Project Team** MERIDIAN FIRS LLC C/O DMCI

PO BOX 111088 TACOMA, WA 98411 (253) 475-2405 DEARTH@DMCIMAIL.COM ARCHITECT: CASEY + DeCHANT ARCHITECTS, LLC PO BOX 456 PUYALLUP, WA 98371 (253) 584-5207 CELL 253-677-0364 LARRY DeCHANT LDECHANT@CASEYDECHANTARCH.COM SOLUTIONS 4 STRUCTURES, INC. 11605 135TH ST. CT. E. **ENGINEER:** PUYALLUP, WA 983742 (253) 314-9822 TOM@SOLUTIONS4STRUCTURES.COM

## Scope of Work

PROVIDE 42" HIGH PHYSICAL BARRIER AT SLIDING GLASS DOOR

TO PREVENT TENANT ACCESS TO EXTERIOR DURING

REMOVE CORNER OF EXISTING CONCRETE PATIOS AS NEEDED POUR NEW CONCRETE FOOTINGS PER DETAILS AT NEW POST LOCATIONS WHERE CALLED OUT.

ADD NEW BEAM & POSTS PER DETAILS WHERE CALLED OUT.

NO REPLACEMENT OF DOORS, WINDOWS, CONC. PATIOS, WALKS PROPOSED OR SCHEDULED.

<u>NTERIOR WORK</u>

1. NO INTERIOR WORK PROPOSED.

## **Drawing Notes**

FOLLOW THE CONSTRUCTION DETAILS IN THE ATTACHED CONSTRUCTION DOCUMENT. HIDDEN OR UNKNOWN DEFECTS ARE NOT ADDRESSED IN THIS DOCUMENT.

BY USING THE CONSTRUCTION DOCUMENTS, CONTRACTOR SITE OBSERVATIONS AND FIELD MEASUREMENTS.

PROVIDE DEMOLITION OF EXISTING MATERIALS AS REQUIRED TO COMPLETE THE SCOPE OF WORK AND AS OUTLINED IN THE CONSTRUCTION DOCUMENTS. LEGALLY DISPOSE OF ALL

INFORMATION SHOWN IN CONSTRUCTION DOCUMENTS IS SUBJECT TO THE REVIEW AND APPROVAL OF THE OF ALL EXISTING UTILITIES BEFORE COMMENCING WORK DAMAGES THAT INCUR DUE TO THE CONTRACTORS FAILURE

## **Owner/Contractor Coordination Notes**

TO LOCATE EXACTLY AND PRESERVE ANY AND ALL

UNDERGROUND UTILITIES.

THE FOLLOWING NOTES SHALL SERVE AS A GUIDE TO THE CONTRACTOR TO VERIFY THE ITEMS OUTLINED BELOW ARE NOT INTENDED TO BE AN EXHAUSTIVE ANALYSIS OF POSSIBLE AREAS OF CONCERN OR CONFLICT, BUT RATHER TO SERVE AS A BEGINNING

POINT IN IDENTIFYING COMMONLY OVERLOOKED AREAS IN THE CONSTRUCTION PROCESS REVIEW SPECIFICATION, MANUFACTURER'S PRODUCT LITERATURE, AND GENERAL NOTE

- SEALANT
  PRESSURE TREATED LUMBER METAL STRUCTURAL HANGERS, CLIPS, STRAPS, ETC MEMBRANE FLASHING
  WEATHER RESISTANT BARRIER
- REVIEW LOCAL & STATE JURISDICTIONAL REQUIREMENTS FOR COMPLETE INSTALLATIONS OF THE FOLLOWING: A. CONCRETE FOOTINGS STRUCTURAL INSPECTIONS
- IF SPECIAL STRUCTURAL INSPECTIONS ARE REQUIRED BY IBC AND/OR THE CITY OF
- DRAWINGS PREPARED BY OTHERS ARE CONSIDERED ADDITIVE TO THE ARCHITECTUR DRAWINGS SUBMITTED

EXISTING CONDITIONS AT DECKS: