## City of Puyallup

## **Engineering Division**

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

## **INSPECTION REPORT**

Date of Inspection: Jun 04, 2025 Inspection Result: PARTIAL PASS

Permit Number: PRCCP20230970

**Property Address:** 3002 E PIONEER, PUYALLUP, 98372

Contractor: MCKEE ENTERPRISES, LLC PO BOX 5 ENUMCLAW, WA 98022

**To construct:** Civil Construction Permit for the East Town Crossing project associated

with Preliminary Site Plan/SEPA, P-21-0034. 3002 E PIONEER

On this day we have inspected your construction for **Engineering Daily Inspection** and we find the following result of the inspection. If there are any questions, please contact the inspector below.

**Comments:** McKee began air testing the storm for phase 1 @3psi for 15min. each.

- SDCB7 to SDCB8 49LF of 8"DI (PASSED) SDCB7 to SDCB6 72LF of 8"DI (PASSED)
- SDCB9 to SDCB6 42LF of 8"CPEP (PASSED) SDCB9 to SDCB5 89LF of 12"DI (PASSED)
- SDCB6 to SDCB5 108LF of 12"DI (PASSED) SDCB6 to SDCB3 72LF of 8"DI (PASSED)
- SDCB3 to SDCB4 54LF of 8"DI (PASSED) SDCB11 to SDCB12 64LF of 8"CPEP (PASSED)
- SDCB11 to SDCB13 79LF of 8"CPEP (PASSED) SDCB14 to SDCB15 43LF of 12"CPEP (PASSED) SDCB14 to SDCB16 68LF of 12"CPEP (PASSED)
- SDCB16 to SDCB17 36LF of 8"DI (PASSED) SDCB40 to SDCB27 52LF of 12"CPEP (PASSED)
- SDCB29 to SDCB30 128LF of 8"DI (PASSED)

McKee began air testing the storm for phase 2 @3psi for 15min. each.

- SDCB38 to SDCB37 54LF of 8"DI (PASSED) SDCB37 to SDCB36 54LF of 8"DI (PASSED)
- SDCB43 to SDCB42 196LF of 24"CPEP (PASSED)

McKee bag flushed the fire hydrant for building "F" (PASSED). Okay to install stortz fitting and make this hydrant live.

#### **Corrections:**


Sincerely,



## City of Puyallup

# **Engineering Division**

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

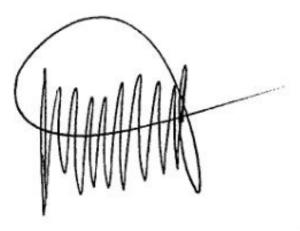

Jason Little
Development Engineering Inspector
JLittle@PuyallupWA.gov
(253) 244-0387