

City of Puyallup **Engineering Division** 333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

INSPECTION REPORT

Date of Inspection:	Jun 05, 2025	Inspection Result:	PARTIAL PASS
Permit Number: Property Address:	PRCCP20240808 911 SHAW RD, PUYALLU 98372; 813 SHAW RD, P		N RD, PUYALLUP, WA
	MCKEE ENTERPRISES, LLC PO BOX 5 ENUMCLAW, WA 98022 Phase 2 site development of East Town Crossing including grading, storm drainage, parking, and utilities per plans 731 SHAW RD		

On this day we have inspected your construction for **Engineering Daily Inspection** and we find the following result of the inspection. If there are any questions, please contact the inspector below.

Comments: McKee air tested storm @ 3-4psi for 15min. each.

Phase 2

- WQ7 to SDCB35 34LF of 12"CPEP (PASSED) - SDCB43 to SDCB46 118LF of 24"CPEP (PASSED) - WQ6 to SDCB31 66LF of 12"CPEP (PASSED) - SDCB34 to SDCB33 70LF of 8"CPEP (PASSED)

- WQ6 to SDCB33 18LF of 12"CPEP (FAILED)

Phase 1 to Phase 2 SDCB23 to SDCB32 33LF & 28LF of 8"DI (PASSED)

Phase 1 SDCB23 to SDCB 22 113LF of 12"DI (FAILED)

McKee flushed fire hydrants for buildings "A, E, Club House, & C" (PASSED) okay to install stortz fitting and make live.

Eagle Asphalt paved the drive isle and finished rocking the parking stalls.

Note: McKee needs to install plugs in the filter vaults.


Corrections:

Sincerely,

City of Puyallup



Engineering Division 333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

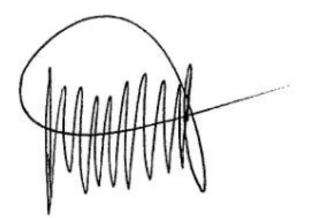

Jason Little Development Engineering Inspector JLittle@PuyallupWA.gov (253) 244-0387