City of Puyallup

Engineering Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

INSPECTION REPORT

Date of Inspection: Jun 06, 2025 Inspection Result: PARTIAL PASS

Permit Number: PRCCP20230970

Property Address: 3002 E PIONEER, PUYALLUP, 98372

Contractor: MCKEE ENTERPRISES, LLC PO BOX 5 ENUMCLAW, WA 98022

To construct: Civil Construction Permit for the East Town Crossing project associated

with Preliminary Site Plan/SEPA, P-21-0034. 3002 E PIONEER

On this day we have inspected your construction for **Engineering Daily Inspection** and we find the following result of the inspection. If there are any questions, please contact the inspector below.

Comments: McKee air tested some sewer and storm @ 3-4psi for 15min each.

- Retest SSMH6 to SSMH9 126LF of 8"pvc w/ 1 6"pvc SS to a c/o and CB for dumpster pad (per PCR001) (PASSED). Note: Still needs to be mandreled.
- Existing SSMH 15 to Existing SSMH14 117LF of 8"pvc (PASSED)
- SDCB27 to SDCB29 82LF of 12"CPEP (PASSED) SDCB24 to SDCB23 69LF of 8"DI (PASSED)
- SDCB24 to SDCB25 34LF of 8"DI (PASSED) SDCB22 to SDCB23 113LF of 12"DI (PASSED)
- SDCB22 to SDCB20 76LF of12"DI (PASSED) WQ6 to SDCB33 18LF of 12"CPEP (PASSED) Another crew replaced the hydrant for building "E".
- Bag flushed hydrant for 15min. twice for building "E" (PASSED)
- Hydro tested hydrant @ 200psi for 2hrs for building "E" (PASSED)

The concrete crew poured the bus canopy pad.

C_{Ω}	rre	cti	on	9
CO	116	CLI	OH	э.


Sincerely,



City of Puyallup

Engineering Division

333 S. Meridian, Puyallup, WA 98371 (253) 864-4165 www.cityofpuyallup.org

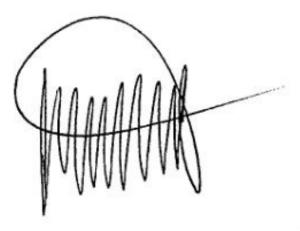

Jason Little
Development Engineering Inspector
JLittle@PuyallupWA.gov
(253) 244-0387