


June 27, 2025

Bradley Heights SS, LLC  
1816C – 11<sup>th</sup> Avenue  
Seattle, Washington 98122

**PRRWF20250216**

Attn: Mr. Jorden Møllergaard  
(509) 899-0326  
jorden@timberlanepartners.com

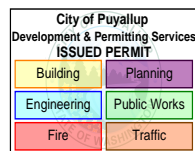

**City of Puyallup  
Building  
REVIEWED  
FOR  
COMPLIANCE**

SKinnear  
02/21/2025  
9:21:56 AM



**Calculations required to be provided by  
the Permittee on site for all Inspections**

Retaining Wall Design Letter  
Proposed Redi-Rock Walls  
Bradley Heights  
202 – 27<sup>th</sup> Avenue East  
Puyallup, Washington  
PN: 0419036006  
Doc: Timberlane.BradleyHeights.RW.rev03

## INTRODUCTION

We are pleased to present this *Retaining Wall Design Letter* for the proposed Redi-Rock retaining walls to be constructed as part of the Bradley Heights development in Puyallup, Washington. The new retaining walls will provide grade separation between the site and the adjacent parcels to the south. We understand the proposed walls will utilize Redi-Rock blocks, constructed in a gravity configuration.

Grading, wall elevations, and wall location information was given in the retaining wall plan sheets G-1, G-8, and G-12 to G-14 prepared by Azure Green Consultants dated April 24, 2025, and June 6, 2025. Soil and design parameters used for the retaining wall designs were based on our previously prepared *Geotechnical Engineering Report* dated February 10, 2022 for the site.

## PURPOSE & SCOPE

The purpose of our services was to prepare a retaining wall design for the proposed project. Specifically, our scope of services for this project included the following:

1. Reviewing available geologic data for the site vicinity;
2. Performing two retaining wall designs using the Redi-Rock proprietary software; and,
3. Providing this written *Retaining Wall Design Letter* summarizing our retaining wall calculation, our geotechnical recommendations and design criteria, along with the supporting data.

## CONCLUSIONS AND RECOMMENDATIONS

Based on our understanding of the project, it is our opinion that the use of a Redi-Rock gravity retaining wall is feasible from a geotechnical standpoint. A total of three different Redi-Rock gravity retaining walls are proposed in the project. The walls are shown and labeled on Site Plan, Figure 1. The design calculations contained in this letter provide verification of the maximum considered configurations of total wall height and surcharges. Proposed Redi-rock walls with lower maximum heights should follow the same block schedule and meet the proposed design height by

removing blocks from the bottom course. Pertinent conclusions and recommendations are provided below.

### **Retaining Wall Design Inputs**

The Redi-Rock concrete block walls should be constructed per the manufacturer's specifications, recommendations contained in our *Geotechnical Engineering Report*, and the recommendations contained herein. The Redi-Rock wall system can be designed both as a gravity wall (without geosynthetic reinforcement) or as a reinforced earth fill wall. For this project, we understand the walls will be designed as gravity walls to be placed in front of cuts. We designed the wall sections using the proprietary Redi-Rock Wall Professional program (which uses GEO5 2024 software) and American Association of State and Highway Transportation Officials (AASHTO) Allowable Strength Design (ASD) methods. Global stability analyses were not performed as part of our scope of work.

#### Block Information

Redi-Rock gravity blocks are cast with knobs on the top of each block that establish the setback for the row of blocks above. The standard Redi-Rock setback is 1.625 inches per block, or approximately a 5-degree batter. The standard Redi-Rock setback blocks were used in our design. The Redi-Rock blocks measure 18 inches tall by approximately 46 inches wide and vary in depth.

#### Wall Design Assumptions

We assumed the walls would be placed in front of a temporary cut slope in the native soils and be backfilled with the excavated soils compacted to at least 95 percent of the maximum dry density (MDD) as determined by ASTM D1557. Our wall designs assume drained conditions with level foreslopes, and 3H:1V (horizontal:vertical) backslopes. Because of site constraints for Wall B (Permit Number PRWWF20252017), slopes behind the wall will be 2H:1V rather than 3H:1V. Calculations indicate Wall B fails in sliding during the maximum considered seismic event. The design earthquake loading for this retaining wall was therefore reduced to half of the  $PGA_M$  of the 975-year return period earthquake (5% in 50 years), determined by the Unified Hazard Tool. This value is a horizontal seismic acceleration coefficient of 0.255g. This earthquake is considered the Design Basis Earthquake per the WSDOT Geotechnical Design Manual and is appropriate for the design of retaining walls. It should be understood that Wall B may fail during the maximum considered event. Calculations for the remaining retaining walls include the original horizontal seismic acceleration coefficient of 0.3g based on half of the mapped  $PGA_M$  for the 2,475-year return period earthquake as stated in our February 2022 report. Passive pressures were not accounted for in our retaining wall design, but we recommend a minimum embedment depth of at least 6 inches for erosion protection.

We used the soil properties in Table 1, below, based on our experience with the soils at the site and typical values per the 2021 WSDOT *Geotechnical Design Manual*, Chapter 5. If the proposed conditions are modified or are not correct, we should be notified and allowed to review our calculations prior to construction of the proposed wall.

**TABLE 1:**  
**SOIL PROPERTIES FOR WALL DESIGN**

Soil Type	Soil Description	Unit Weight (pcf)	Cohesion (psf)	Phi (degrees)
SM	Retained Soil (Recessional Outwash)	130	0	34
GW-GM	Crushed Surfacing Top Course (CSTC, Leveling Pad)	130	0	40
GP	Structural Fill	130	0	36

#### Wall Bearing Surfaces

We assumed that the walls will be founded on a leveling pad of crushed rock supported on suitable native soils. The compacted leveling pad of crushed rock should have a minimum thickness of 6 inches, that extends a minimum of 6-inches in all directions from the base blocks.

#### **Gravity Retaining Wall Design**

Table 2, below, describes block dimensions and configuration for the gravity wall sections. Details for each wall are included as Figures 2a to 2c. Calculations for the wall sections described are provided in Appendix A. Standard details from the manufacturer are included in Appendix B.

**TABLE 2:**  
**REDI ROCK GRAVITY WALL CONFIGURATION**

Section	# Rows of Blocks	Row No. (Bottom up)	Block Size (Inches)	Setback (Inches)	Total Wall Height (feet)	Surcharges
Wall A1 <sup>2</sup>	6	1-2	60	1.625	9.0	Seismic, 3H:1V backslope
		3-4	41	1.625		
		5	28	1.625		
		6	28T <sup>1</sup>	1.625		
Wall A2 <sup>3</sup>	6	1-2	60	1.625	9.0	Seismic, 3H:1V backslope
		3-4	41	1.625		
		5	28	1.625		
		6	28T <sup>1</sup>	1.625		
Wall B <sup>4</sup>	5	1	60	1.625	7.5	Seismic, 2H:1V backslope
		2-3	41	1.625		
		4	28	1.625		
		5	28T <sup>1</sup>	1.625		
<sup>1</sup> = 28-inch-wide top block <sup>2</sup> = Permit Number: PRRWF20250214 <sup>3</sup> = Permit Number: PRWWF20250216 <sup>4</sup> = Permit Number: PRWWF20250217						

#### **Wall Drainage**

Drainage behind all walls should be constructed in accordance with the “**Wall Drainage**” section of our previously prepared *Geotechnical Engineering Report* dated February 10, 2022. We

understand that the wall drain will be connected to the site's drainage system and discharged to an appropriate location.

### **Structural Fill**

All fill associated with the proposed walls should be placed as structural fill in accordance with the "**Structural Fill**" section of our previously prepared *Geotechnical Engineering Report* dated February 10, 2022.

### **Temporary Excavations**

Temporary excavations should be constructed in accordance with the "**Temporary Excavations**" section of our previously prepared *Geotechnical Engineering Report* dated February 10, 2022. The soils in the area of these walls likely consists of glacial till, which would be classified as a Type A soil. For temporary excavations of less than 20 feet in depth, the side slopes in Type A soils should be sloped at a maximum inclination of  $\frac{3}{4}$ H:1V or flatter from the toe to top of the slope. Based on our conversations with the project Civil Engineer, and our review of the project plans, a 1H:1V temporary cut slope was assumed. We also understand that the walls have been pushed further away from the property line so that the temporary excavations do not extend onto the neighboring properties.

### **Additional Services and Construction Observation**

We recommend GeoResources be retained to observe the geotechnical aspects of construction, particularly the wall subgrade, fill placement and compaction, and drainage activities, including the wall drainage course. This observation would allow us to verify the subsurface conditions as they are exposed during construction and to determine that work is accomplished in accordance with recommendations.

## **LIMITATIONS**

We have prepared this *Retaining Wall Design Letter* for Bradley Heights SS, LLC, Timberlane Partners and other members of the design team for use in evaluating a portion of this project. Subsurface conditions described herein were based on our previous subsurface explorations at the site.

The analyses, conclusions, and recommendations contained in this report are based on site conditions as they presently exist. We did not perform additional subsurface explorations for this project. If actual conditions differ from those observed previously for the site are observed or appear to be present during construction, we should be advised at once so that we can review these conditions and reconsider our recommendations, where necessary. If there is a substantial lapse of time between submission of our report and the start of work at the site, or if conditions have changed because of natural forces or construction operations at or near the site, it is recommended that this report be reviewed to determine the applicability of the conclusions and recommendations.

This report may be made available to regulatory agencies or others, but this report and conclusions should not be construed as a warranty of subsurface conditions. Subsurface conditions can vary over short distances and can change with time. The scope of our services did not include geotechnical investigation, environmental assessment or evaluation regarding the presence or

absence of wetlands or hazardous or toxic materials in the soil, surface water, groundwater, or air at the subject site other than those activities described in this report.


Within the limitations of scope, schedule and budget, our services have been executed in accordance with generally accepted practices in this area at the time.




We have appreciated the opportunity to be of service to you on this project. If you have any questions or comments, please do not hesitate to call at your earliest convenience.

Respectfully submitted,

GeoResources, LLC

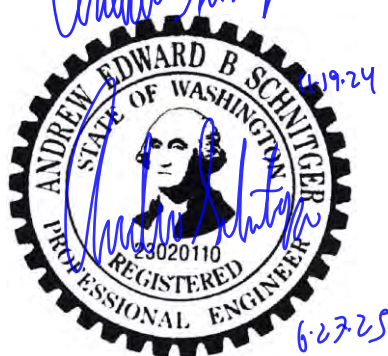

Andrew Schnitger, PE  
Project Engineer

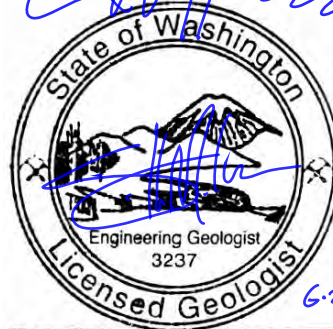

Seth Taylor Mattos

Seth Mattos, LEG  
Associate

AES:STM/aes

DocID: Timberlane.BradleyHeights.RW.rev03

Attachments: Figure 1: Site Plan  
Figure 2a-2c: Redi-Rock Wall Details  
Appendix A: Redi-Rock Retaining Wall Calculations  
Appendix B: Block Manufacturer Standard Details



Approval of submitted plans is not an approval of omissions or oversights by this office or non compliance with any applicable regulations of local government. The contractor is responsible for making sure that the building complies with all applicable codes and regulations of the local government.

No proposed footings, posts, or supports shall be constructed on or above any existing public utility connections without first relocating the utility services or protecting it in place.


The approved construction plans, documents, and all engineering must be posted on the job at all inspections in a visible and readily accessible location.

Full sized legible color plans are required to be provided by the permittee on site for inspection.

PRRWF20250216

Permit is for Wall A2 as identified on the Civil Plans (PRCCP20240845), Sheet G-8.


Wall 3 or Wall B as Identified on the Civil Plans is not part of this permit. See permit PRRWF20250217

City of Puyallup  
Building  
REVIEWED  
FOR  
COMPLIANCE  
  
SKinnear  
02/21/2025  
9:21:14 AM  


See Geotechnical Report provided as part of the Civil Permit (PRCCP20240845), Page 10-11, Temporary Excavations for excavation requirements of temporary cut slope and protection of structures.

Wall 1 or Wall A1 as Identified on the Civil Plans is not part of this permit. See permit PRRWF20250214

Notes  
Excerpt from Sheet G-8 of the Grading Plan prepared by Azure Green dated April 24, 2025

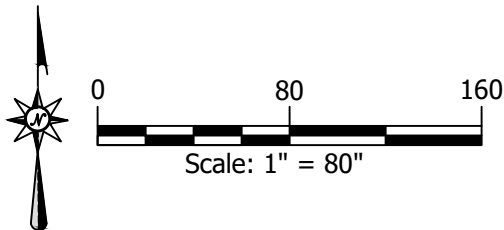




**GEORESOURCES**  
earth science & geotechnical engineering  
4809 Pacific Hwy. E. | Fife, WA 98424 | 253.896.1011 | www.georesources.rocks

Site Plan  
Proposed Redi-Rock Walls  
Bradley Heights  
202 - 27th Avenue East  
Puyallup, Washington  
PN: 0419036006

See Geotechnical Report provided as part of the Civil Permit (PRCCP20240845), Page 10-11, Temporary Excavations for excavation requirements of temporary cut slope and protection of structures.

The retaining wall weep hole drain system is not permitted. The retaining wall footing drain will connect to the site's storm system as designed under civil construction permit PRCCP20240845.

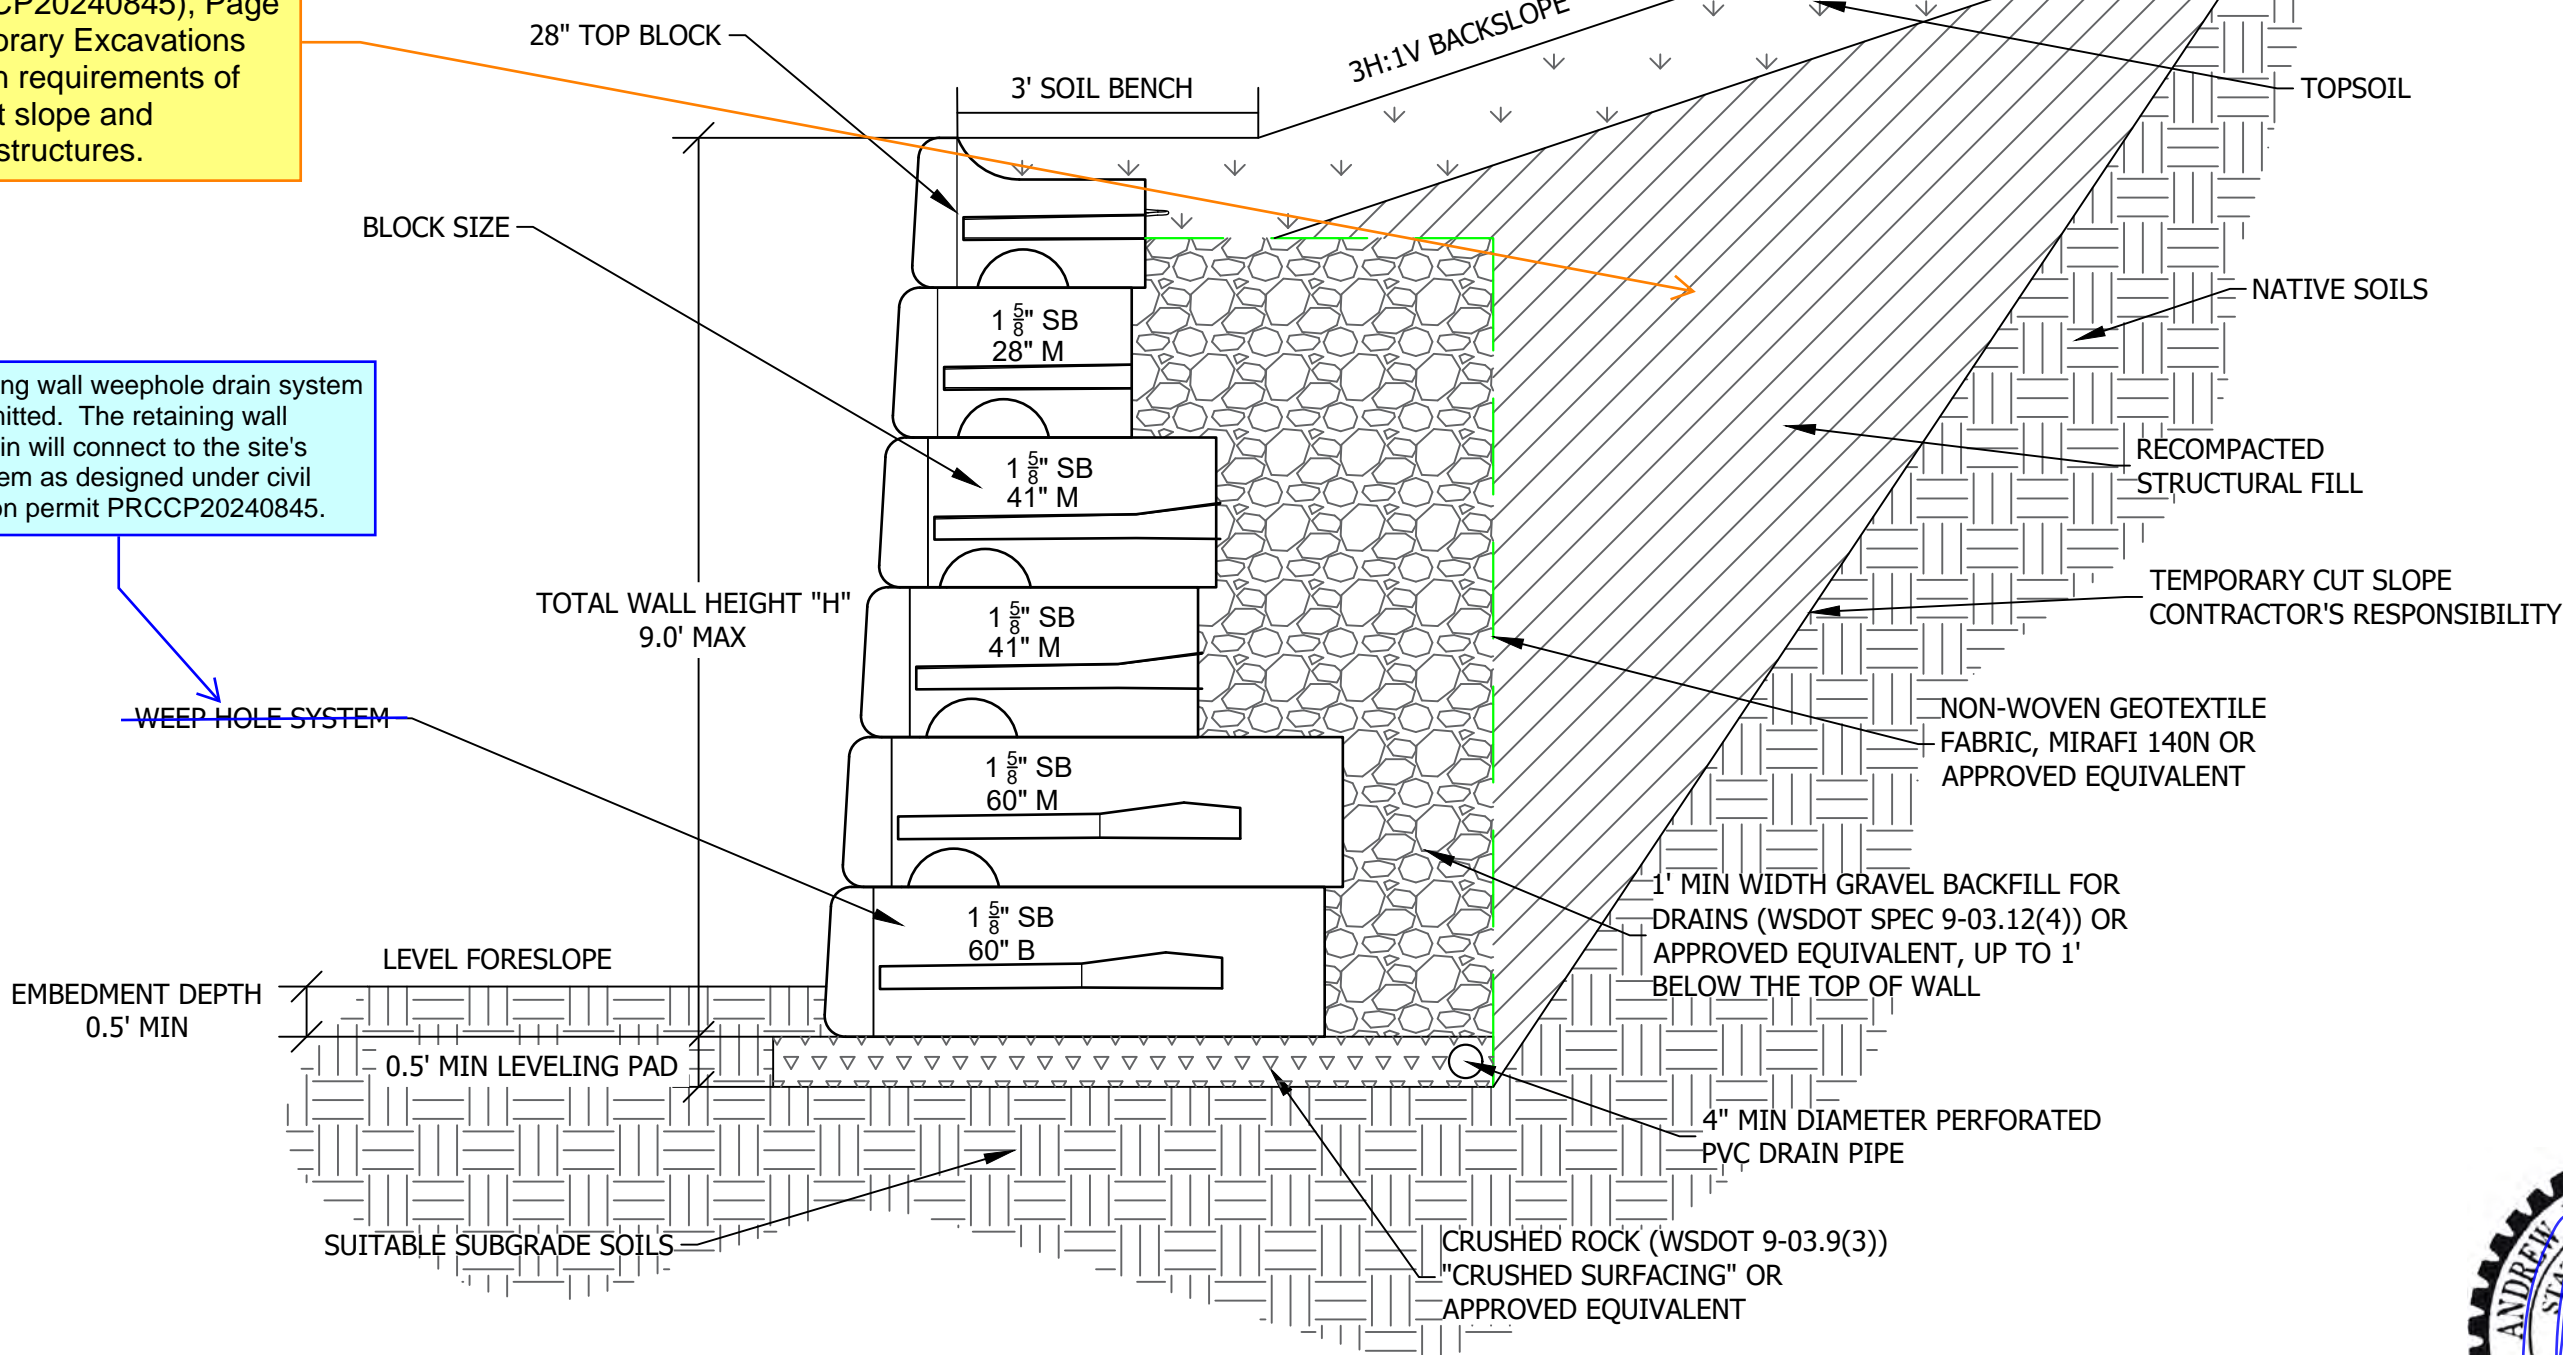

WALL A1  
(NO SCALE)




- Notes**
- 1. SEE RETAINING WALL DESIGN LETTER FOR FURTHER DETAILS
  - 2. WALLS SHOULD BE CONSTRUCTED IN ACCORDANCE WITH MANUFACTURER'S AND GEORESOURCES' RECOMMENDATION



**Wall A1 Typical Detail**  
Proposed Redi-Rock Walls  
Bradley Heights  
202 - 27th Avenue East  
Puyallup, Washington  
PN: 0419036006



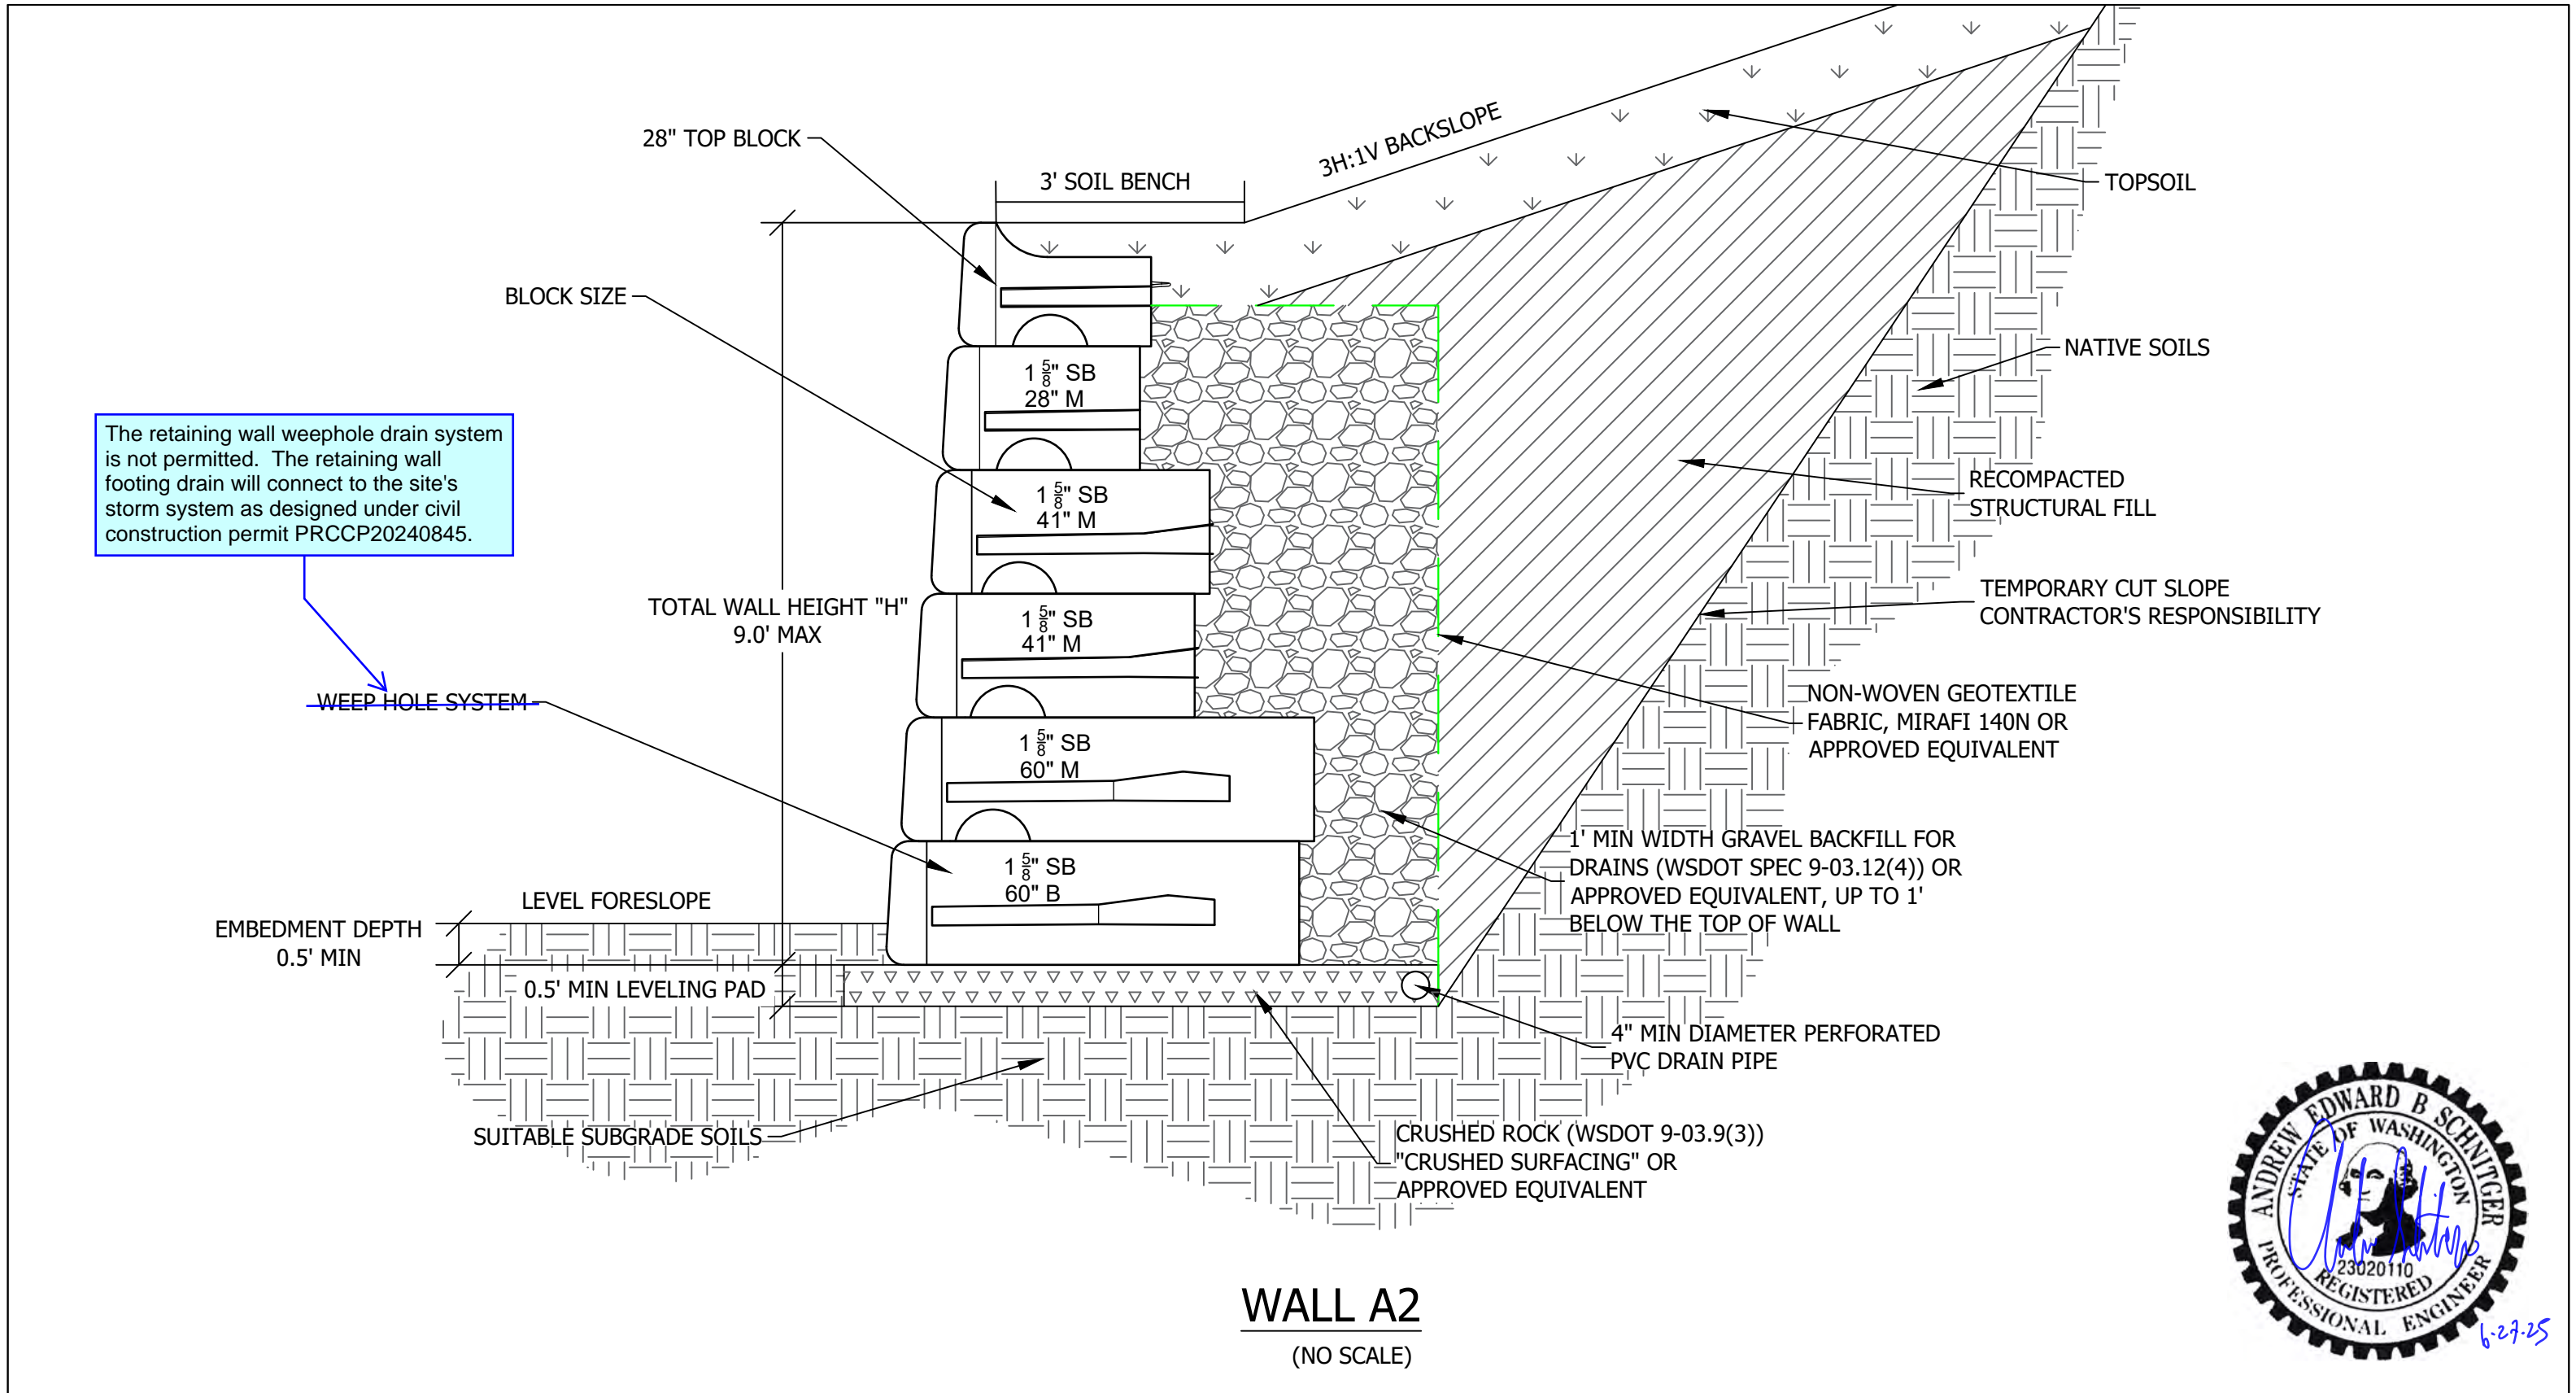

- Notes**
- 1. SEE RETAINING WALL DESIGN LETTER FOR FURTHER DETAILS
  - 2. WALLS SHOULD BE CONSTRUCTED IN ACCORDANCE WITH MANUFACTURER'S AND GEORESOURCES' RECOMMENDATION



**Wall A2 Typical Detail**


Proposed Redi-Rock Walls  
Bradley Heights  
202 - 27th Avenue East  
Puyallup, Washington  
PN: 0419036006

DocID: Timberlane.BradleyHeights.F

June 2025

Figure 2b



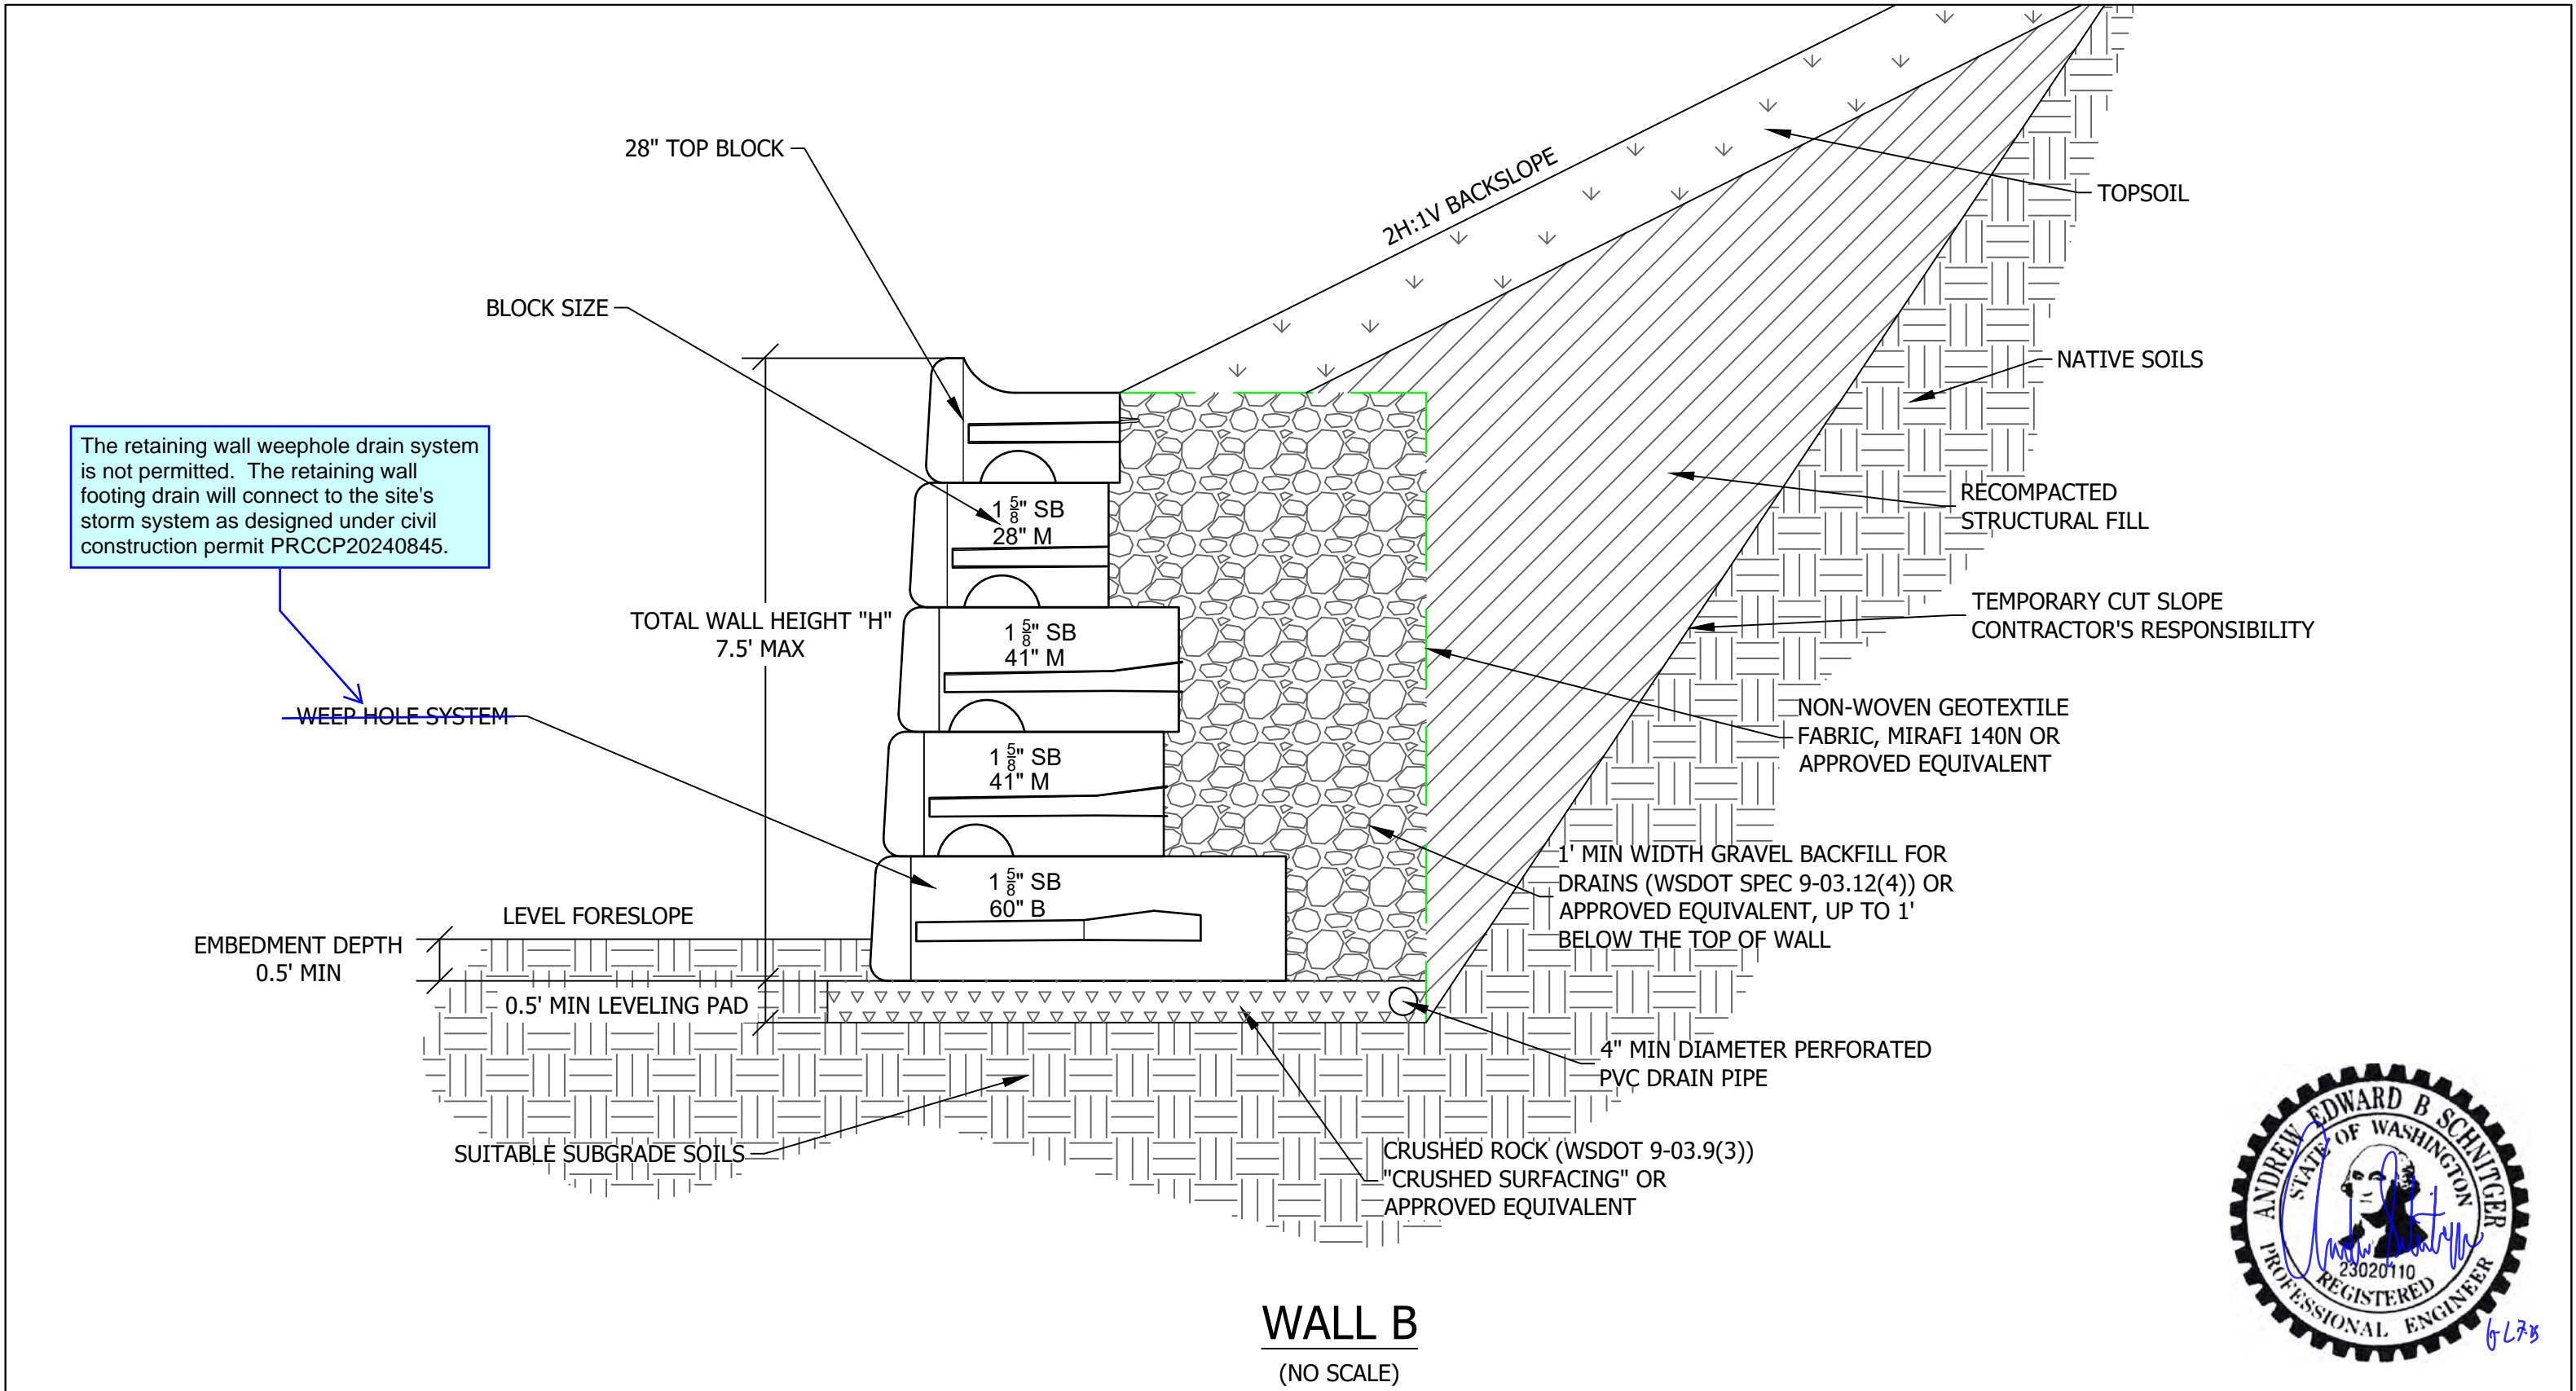

- Notes**
1. SEE RETAINING WALL DESIGN LETTER FOR FURTHER DETAILS
  2. WALLS SHOULD BE CONSTRUCTED IN ACCORDANCE WITH MANUFACTURER'S AND GEORESOURCES' RECOMMENDATION



**Wall B Typical Detail**  
Proposed Redi-Rock Walls  
Bradley Heights  
202 - 27th Avenue East  
Puyallup, Washington  
PN: 0419036006

DocID: Timberlane.BradleyHeights.F	June 2025	Figure 2c
------------------------------------	-----------	-----------

## **Appendix A**

### Redi-Rock Retaining Wall Calculations


## Analysis of Redi Rock wall

### Input data (Stage of construction 1)

Project : 9 FOOT WALL LEVEL BACKSLOPE  
Customer : BRADLEY HEIGHTS SS,LLC  
Author : AES  
Date : 11/12/2024  
Project ID : TIMBERLANE.BRADLEY HEIGHTS

Name : 9 foot with slopes

Stage - analysis : 1 - 0

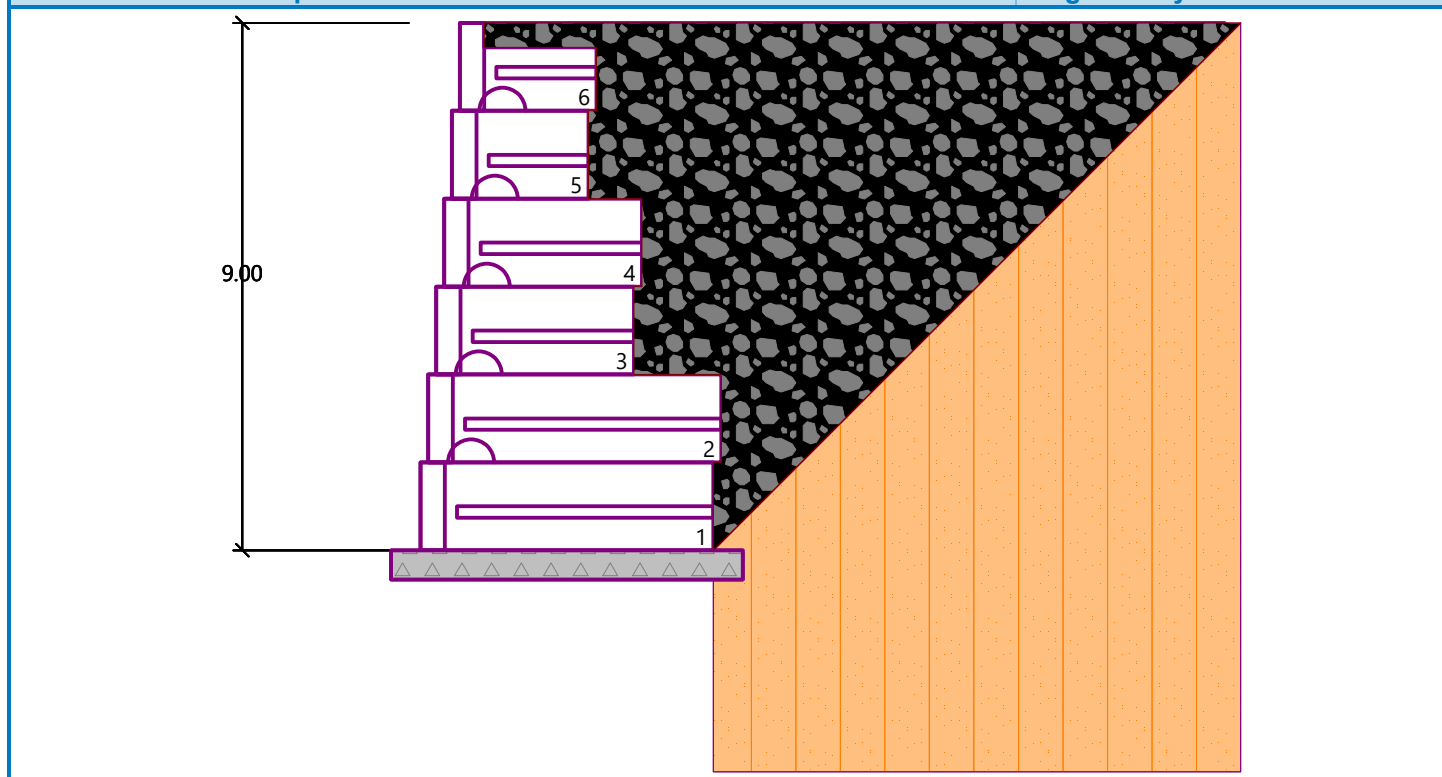

### Settings

(input for current task)

### Wall analysis

Verification methodology :	Safety factors (ASD)
Active earth pressure calculation :	Coulomb
Passive earth pressure calculation :	Mazindrani (Rankine)
Earthquake analysis :	Mononobe-Okabe
Shape of earth wedge :	Calculate as skew
Allowable eccentricity :	0.333
Internal stability :	Standard - straight slip surface
Reduction coeff. of contact first block - base :	1.00

Safety factors			
Permanent design situation			
Safety factor for overturning :	SF <sub>o</sub> =	1.50	[-]
Safety factor for sliding resistance :	SF <sub>s</sub> =	1.50	[-]



Safety factors			
Permanent design situation			
Safety factor for bearing capacity :	$SF_b =$	2.00	[-]
Safety factor for sliding along geo-reinforcement :	$SF_{sr} =$	1.50	[-]
Safety factor for geo-reinforcement strength :	$SF_{st} =$	1.50	[-]
Safety factor for pull out resistance of geo-reinf. :	$SF_{po} =$	1.50	[-]
Safety factor for connection strength :	$SF_{con} =$	1.50	[-]

Safety factors			
Seismic design situation			
Safety factor for overturning :	$SF_o =$	1.12	[-]
Safety factor for sliding resistance :	$SF_s =$	1.12	[-]
Safety factor for bearing capacity :	$SF_b =$	1.50	[-]
Safety factor for sliding along geo-reinforcement :	$SF_{sr} =$	1.12	[-]
Safety factor for geo-reinforcement strength :	$SF_{st} =$	1.12	[-]
Safety factor for pull out resistance of geo-reinf. :	$SF_{po} =$	1.12	[-]
Safety factor for connection strength :	$SF_{con} =$	1.12	[-]

**Blocks**

No.	Description	Block height h [in]	Block width w [in]	Unit weight $\gamma$ [pcf]
1	Block 28	18.00	28.00	120.00
2	Block 41	18.00	40.50	120.00
3	Block 60	18.00	60.00	130.00
4	Top block 28	18.00	28.00	120.00

No.	Description	Shear bearing capacity of joint $F_{min}$ [lbf/ft]	Max. shear strength $F_{max}$ [lbf/ft]	Block friction $f$ [°]
1	Block 28	6061.00	11276.00	44.00
2	Block 41	6061.00	11276.00	44.00
3	Block 60	6061.00	11276.00	44.00
4	Top block 28	6061.00	11276.00	44.00

**Setbacks**

No.	Setback s [in]
1	0.000
2	0.033
3	0.135
4	0.781
5	1.385




**Geometry**

No. group	Description	Count	Setback s [in]
1	Block 60	2	0.13
2	Block 41	2	0.13
3	Block 28	1	0.13
4	Top block 28	1	-

**Base****Geometry**Upper setback  $a_1 = 0.50$  ftLower setback  $a_2 = 0.50$  ftHeight  $h = 0.50$  ftWidth  $b = 6.00$  ft**Material**

Soil creating foundation - CSTC

**Basic soil parameters**

No.	Name	Pattern	$\Phi_{ef}$ [°]	$C_{ef}$ [psf]	$\gamma$ [pcf]	$\gamma_{su}$ [pcf]	$\delta$ [°]
1	Retained Soils		34.00	0.0	130.00	67.50	22.78
2	CSTC		40.00	0.0	130.00	67.50	26.80
3	Structural Fill		36.00	0.0	130.00	67.50	24.12

All soils are considered as cohesionless for at rest pressure analysis.

**Soil parameters****Retained Soils**Unit weight :  $\gamma = 130.0$  pcf

Stress-state : effective

Angle of internal friction :  $\Phi_{ef} = 34.00^\circ$ Cohesion of soil :  $C_{ef} = 0.0$  psfAngle of friction struc.-soil :  $\delta = 22.78^\circ$ Saturated unit weight :  $\gamma_{sat} = 130.0$  pcf**CSTC**Unit weight :  $\gamma = 130.0$  pcf

Stress-state : effective

Angle of internal friction :  $\Phi_{ef} = 40.00^\circ$ Cohesion of soil :  $C_{ef} = 0.0$  psfAngle of friction struc.-soil :  $\delta = 26.80^\circ$ Saturated unit weight :  $\gamma_{sat} = 130.0$  pcf**Structural Fill**Unit weight :  $\gamma = 130.0$  pcf

Stress-state : effective


Angle of internal friction :  $\Phi_{ef} = 36.00^\circ$ Cohesion of soil :  $C_{ef} = 0.0$  psf

Angle of friction struc.-soil :  $\delta = 24.12^\circ$   
Saturated unit weight :  $\gamma_{\text{sat}} = 130.0 \text{ pcf}$

### Backfill

Assigned soil : Structural Fill  
Slope =  $45.00^\circ$

### Geological profile and assigned soils

No.	Thickness of layer t [ft]	Depth z [ft]	Assigned soil	Pattern
1		- 0.00 .. $\infty$	Retained Soils	

### Terrain profile

Terrain behind the structure is flat.

### Water influence

Ground water table is located below the structure.

### Resistance on front face of the structure

Resistance on front face of the structure is not considered.

### Settings of the stage of construction

Design situation : permanent

Reduction of soil/soil friction angle : do not reduce

### Verification No. 1 (Stage of construction 1)

#### Forces acting on construction

Name	$F_{\text{hor}}$ [lbf/ft]	App.Pt. z [ft]	$F_{\text{vert}}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.72	4303.1	2.77	1.000
Weight - earth wedge	0.0	-0.80	29.3	5.68	1.000
Weight - earth wedge	0.0	-4.40	260.5	4.68	1.000
Weight - earth wedge	0.0	-7.00	89.3	3.72	1.000
Weight - earth wedge	0.0	-9.29	98.1	2.50	1.000
Active pressure	1384.0	-3.22	1806.3	5.16	1.000

### Verification of complete wall

#### Check for overturning stability

Resisting moment  $M_{\text{res}} = 23187.5 \text{ lbfft/ft}$

Overturning moment  $M_{\text{ovr}} = 4456.9 \text{ lbfft/ft}$

Safety factor =  $5.20 > 1.50$

**Wall for overturning is SATISFACTORY**

#### Check for slip

Resisting horizontal force  $H_{\text{res}} = 4442.69 \text{ lbf/ft}$

Active horizontal force  $H_{\text{act}} = 1384.03 \text{ lbf/ft}$

Safety factor =  $3.21 > 1.50$

**Wall for slip is SATISFACTORY**



**Overall check - WALL is SATISFACTORY****Dimensioning No. 1 (Stage of construction 1)****Forces acting on construction**

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.56	3913.1	2.24	1.000
Weight - earth wedge	0.0	-3.90	260.5	4.18	1.000
Weight - earth wedge	0.0	-6.50	89.3	3.22	1.000
Weight - earth wedge	0.0	-8.79	98.1	2.00	1.000
Active pressure	1185.6	-3.18	1316.5	4.40	1.000

**Verification of most stressed block No. 1****Check for overturning stability**Resisting moment  $M_{res} = 16150.0$  lbfft/ftOverturning moment  $M_{ovr} = 3775.0$  lbfft/ft

Safety factor = 4.28 &gt; 1.50

**Joint for overturning stability is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 4763.90$  lbf/ftActive horizontal force  $H_{act} = 1185.59$  lbf/ft

Safety factor = 4.02 &gt; 1.50

**Joint for verification is SATISFACTORY****Bearing capacity of foundation soil (Stage of construction 1)****Design load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]	Eccentricity [-]	Stress [psf]
1	1029.1	6586.56	1384.03	0.026	1158.1

**Service load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]
1	1029.1	6586.56	1384.03

**Verification of foundation soil**

Stress in the footing bottom : rectangle

**Eccentricity verification**Max. eccentricity of normal force  $e = 0.026$ Maximum allowable eccentricity  $e_{alw} = 0.333$ **Eccentricity of the normal force is SATISFACTORY****Verification of bearing capacity**Max. stress at footing bottom  $\sigma = 1158.1$  psfAllowable bearing capacity of foundation soil  $R_d = 6000.0$  psf


Safety factor = 5.18 &gt; 2.00

**Bearing capacity of foundation soil is SATISFACTORY**

**Overall verification - bearing capacity of found. soil is SATISFACTORY**

### Input data (Stage of construction 2)

#### Geological profile and assigned soils

No.	Thickness of layer t [ft]	Depth z [ft]	Assigned soil	Pattern
1		- 0.00 .. ∞	Retained Soils	

#### Terrain profile

Terrain behind the structure is flat.

#### Water influence

Ground water table is located below the structure.

#### Resistance on front face of the structure

Resistance on front face of the structure is not considered.

#### Earthquake

Factor of horizontal acceleration  $K_h = 0.3000$

Factor of vertical acceleration  $K_v = 0.0000$

Water below the GWT is restricted.

#### Settings of the stage of construction

Design situation : seismic

Reduction of soil/soil friction angle : do not reduce

### Verification No. 1 (Stage of construction 2)

#### Forces acting on construction

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.72	4303.1	2.77	1.000
Earthq.- constr.	1292.3	-3.79	0.0	2.75	1.000
Weight - earth wedge	0.0	-0.80	29.3	5.68	1.000
Earthquake - soil wedge	8.8	-0.80	0.0	5.68	1.000
Weight - earth wedge	0.0	-4.40	260.5	4.68	1.000
Earthquake - soil wedge	78.1	-4.40	0.0	4.68	1.000
Weight - earth wedge	0.0	-7.00	89.3	3.72	1.000
Earthquake - soil wedge	26.8	-7.00	0.0	3.72	1.000
Weight - earth wedge	0.0	-9.29	98.1	2.50	1.000
Earthquake - soil wedge	29.4	-9.29	0.0	2.50	1.000
Active pressure	1384.0	-3.22	1806.3	5.16	1.000
Earthq.- act.pressure	1604.8	-6.33	2448.9	4.32	1.000

#### Verification of complete wall

##### Check for overturning stability

Resisting moment  $M_{res} = 33759.8$  lbfft/ft

Overturning moment  $M_{ovr} = 20336.4$  lbfft/ft

Safety factor = 1.66 > 1.12

**Wall for overturning is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 6094.52$  lbf/ftActive horizontal force  $H_{act} = 4424.28$  lbf/ft

Safety factor = 1.38 &gt; 1.12

**Wall for slip is SATISFACTORY****Overall check - WALL is SATISFACTORY****Dimensioning No. 1 (Stage of construction 2)****Forces acting on construction**

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-2.61	1963.1	1.66	1.000
Earthq.- constr.	616.6	-2.58	0.0	1.65	1.000
Weight - earth wedge	0.0	-3.50	89.3	2.95	1.000
Earthquake - soil wedge	26.8	-3.50	0.0	2.95	1.000
Weight - earth wedge	0.0	-5.79	98.1	1.73	1.000
Earthquake - soil wedge	29.4	-5.79	0.0	1.73	1.000
Active pressure	500.7	-2.10	383.7	3.24	1.000
Earthq.- act.pressure	599.2	-4.07	752.8	2.97	1.000

**Verification of most stressed block No. 3****Check for overturning stability**Resisting moment  $M_{res} = 7164.0$  lbfft/ftOverturning moment  $M_{ovr} = 5346.7$  lbfft/ft

Safety factor = 1.34 &gt; 1.12

**Joint for overturning stability is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 9235.23$  lbf/ftActive horizontal force  $H_{act} = 1772.82$  lbf/ft

Safety factor = 5.21 &gt; 1.12

**Joint for verification is SATISFACTORY****Bearing capacity of foundation soil (Stage of construction 2)****Design load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]	Eccentricity [-]	Stress [psf]
1	13683.2	9035.49	4424.28	0.252	3041.0

**Service load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]
1	13683.2	9035.49	4424.28



### Verification of foundation soil

Stress in the footing bottom : rectangle

#### Eccentricity verification

Max. eccentricity of normal force  $e = 0.252$

Maximum allowable eccentricity  $e_{alw} = 0.333$

**Eccentricity of the normal force is SATISFACTORY**

#### Verification of bearing capacity

Max. stress at footing bottom  $\sigma = 3041.0$  psf

Allowable bearing capacity of foundation soil  $R_d = 9000.0$  psf

Safety factor =  $2.96 > 1.50$

**Bearing capacity of foundation soil is SATISFACTORY**

**Overall verification - bearing capacity of found. soil is SATISFACTORY**


## Analysis of Redi Rock wall

### Input data (Stage of construction 1)

Project : 9 FOOT WALL WITH SLOPES  
Customer : BRADLEY HEIGHTS SS,LLC  
Author : AES  
Date : 11/12/2024  
Project ID : TIMBERLANE.BRADLEY HEIGHTS

Name : 9 foot with slopes

Stage - analysis : 1 - 0

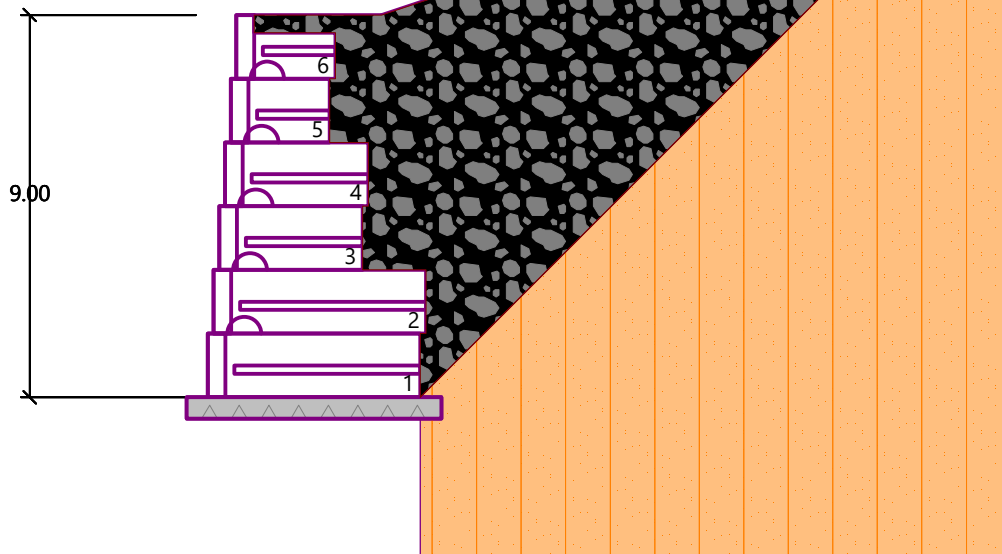

### Settings

(input for current task)

### Wall analysis

Verification methodology :	Safety factors (ASD)
Active earth pressure calculation :	Coulomb
Passive earth pressure calculation :	Mazindrani (Rankine)
Earthquake analysis :	Mononobe-Okabe
Shape of earth wedge :	Calculate as skew
Allowable eccentricity :	0.333
Internal stability :	Standard - straight slip surface
Reduction coeff. of contact first block - base :	1.00

### Safety factors

#### Permanent design situation

Safety factor for overturning :	SF <sub>o</sub> =	1.50	[-]
Safety factor for sliding resistance :	SF <sub>s</sub> =	1.50	[-]

## Safety factors

## Permanent design situation

Safety factor for bearing capacity :	$SF_b =$	2.00	[-]
Safety factor for sliding along geo-reinforcement :	$SF_{sr} =$	1.50	[-]
Safety factor for geo-reinforcement strength :	$SF_{st} =$	1.50	[-]
Safety factor for pull out resistance of geo-reinf. :	$SF_{po} =$	1.50	[-]
Safety factor for connection strength :	$SF_{con} =$	1.50	[-]

## Safety factors

## Seismic design situation

Safety factor for overturning :	$SF_o =$	1.12	[-]
Safety factor for sliding resistance :	$SF_s =$	1.12	[-]
Safety factor for bearing capacity :	$SF_b =$	1.50	[-]
Safety factor for sliding along geo-reinforcement :	$SF_{sr} =$	1.12	[-]
Safety factor for geo-reinforcement strength :	$SF_{st} =$	1.12	[-]
Safety factor for pull out resistance of geo-reinf. :	$SF_{po} =$	1.12	[-]
Safety factor for connection strength :	$SF_{con} =$	1.12	[-]

## Blocks

No.	Description	Block height h [in]	Block width w [in]	Unit weight $\gamma$ [pcf]
1	Block 28	18.00	28.00	120.00
2	Block 41	18.00	40.50	120.00
3	Block 60	18.00	60.00	130.00
4	Top block 28	18.00	28.00	120.00

No.	Description	Shear bearing capacity of joint $F_{min}$ [lbf/ft]	Max. shear strength $F_{max}$ [lbf/ft]	Block friction $f$ [°]
1	Block 28	6061.00	11276.00	44.00
2	Block 41	6061.00	11276.00	44.00
3	Block 60	6061.00	11276.00	44.00
4	Top block 28	6061.00	11276.00	44.00

## Setbacks

No.	Setback s [in]
1	0.000
2	0.033
3	0.135
4	0.781
5	1.385






**Geometry**

No. group	Description	Count	Setbacks [in]
1	Block 60	2	0.13
2	Block 41	2	0.13
3	Block 28	1	0.13
4	Top block 28	1	-

**Base****Geometry**Upper setback  $a_1 = 0.50$  ftLower setback  $a_2 = 0.50$  ftHeight  $h = 0.50$  ftWidth  $b = 6.00$  ft**Material**

Soil creating foundation - CSTC

**Basic soil parameters**

No.	Name	Pattern	$\Phi_{ef}$ [°]	$C_{ef}$ [psf]	$\gamma$ [pcf]	$\gamma_{su}$ [pcf]	$\delta$ [°]
1	Retained Soils		34.00	0.0	130.00	67.50	22.78
2	CSTC		40.00	0.0	130.00	67.50	26.80
3	Structural Fill		36.00	0.0	130.00	67.50	24.12

All soils are considered as cohesionless for at rest pressure analysis.

**Soil parameters****Retained Soils**

Unit weight :  $\gamma = 130.0$  pcf  
Stress-state : effective  
Angle of internal friction :  $\Phi_{ef} = 34.00^\circ$   
Cohesion of soil :  $C_{ef} = 0.0$  psf  
Angle of friction struc.-soil :  $\delta = 22.78^\circ$   
Saturated unit weight :  $\gamma_{sat} = 130.0$  pcf

**CSTC**

Unit weight :  $\gamma = 130.0$  pcf  
Stress-state : effective  
Angle of internal friction :  $\Phi_{ef} = 40.00^\circ$   
Cohesion of soil :  $C_{ef} = 0.0$  psf  
Angle of friction struc.-soil :  $\delta = 26.80^\circ$   
Saturated unit weight :  $\gamma_{sat} = 130.0$  pcf

**Structural Fill**


Unit weight :  $\gamma = 130.0$  pcf  
Stress-state : effective  
Angle of internal friction :  $\Phi_{ef} = 36.00^\circ$   
Cohesion of soil :  $C_{ef} = 0.0$  psf

Angle of friction struc.-soil :  $\delta = 24.12^\circ$   
Saturated unit weight :  $\gamma_{\text{sat}} = 130.0 \text{ pcf}$

### Backfill

Assigned soil : Structural Fill  
Slope =  $45.00^\circ$

### Geological profile and assigned soils

No.	Thickness of layer t [ft]	Depth z [ft]	Assigned soil	Pattern
1		- 0.00 .. $\infty$	Retained Soils	

### Terrain profile

No.	Coordinates x [ft]	Depth z [ft]
1	0.00	0.00
2	3.00	0.00
3	18.00	-5.00
4	19.00	-5.00

Origin [0,0] is located in upper right edge of construction.  
Positive coordinate +z has downward direction.

### Water influence

Ground water table is located below the structure.

### Resistance on front face of the structure

Resistance on front face of the structure is not considered.

### Settings of the stage of construction

Design situation : permanent  
Reduction of soil/soil friction angle : do not reduce

### Verification No. 1 (Stage of construction 1)

#### Forces acting on construction

Name	$F_{\text{hor}}$ [lbf/ft]	App.Pt. z [ft]	$F_{\text{vert}}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.72	4303.1	2.77	1.000
Weight - earth wedge	0.0	-0.87	36.3	5.68	1.000
Weight - earth wedge	0.0	-5.36	447.2	4.41	1.000
Weight - earth wedge	0.0	-9.29	98.1	2.50	1.000
Active pressure	1747.2	-3.16	2116.7	5.25	1.000

### Verification of complete wall

#### Check for overturning stability

Resisting moment  $M_{\text{res}} = 25440.1 \text{ lbfft/ft}$   
Overturning moment  $M_{\text{ovr}} = 5527.2 \text{ lbfft/ft}$

Safety factor =  $4.60 > 1.50$

**Wall for overturning is SATISFACTORY**

**Check for slip**Resisting horizontal force  $H_{res} = 4722.50$  lbf/ftActive horizontal force  $H_{act} = 1747.21$  lbf/ft

Safety factor = 2.70 &gt; 1.50

**Wall for slip is SATISFACTORY****Overall check - WALL is SATISFACTORY****Dimensioning No. 1 (Stage of construction 1)****Forces acting on construction**

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.56	3913.1	2.24	1.000
Weight - earth wedge	0.0	-4.86	447.2	3.91	1.000
Weight - earth wedge	0.0	-8.79	98.1	2.00	1.000
Active pressure	1448.6	-3.20	1487.1	4.49	1.000

**Verification of most stressed block No. 1****Check for overturning stability**Resisting moment  $M_{res} = 17405.8$  lbfft/ftOverturning moment  $M_{ovr} = 4629.2$  lbfft/ft

Safety factor = 3.76 &gt; 1.50

**Joint for overturning stability is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 4988.86$  lbf/ftActive horizontal force  $H_{act} = 1448.65$  lbf/ft

Safety factor = 3.44 &gt; 1.50

**Joint for verification is SATISFACTORY****Bearing capacity of foundation soil (Stage of construction 1)****Design load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]	Eccentricity [-]	Stress [psf]
1	1091.2	7001.39	1747.21	0.026	1230.8

**Service load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]
1	1091.2	7001.39	1747.21

**Verification of foundation soil**


Stress in the footing bottom : rectangle

**Eccentricity verification**Max. eccentricity of normal force  $e = 0.026$ Maximum allowable eccentricity  $e_{alw} = 0.333$

**Eccentricity of the normal force is SATISFACTORY****Verification of bearing capacity**Max. stress at footing bottom  $\sigma = 1230.8$  psfAllowable bearing capacity of foundation soil  $R_d = 6000.0$  psf

Safety factor = 4.87 &gt; 2.00

**Bearing capacity of foundation soil is SATISFACTORY****Overall verification - bearing capacity of found. soil is SATISFACTORY****Input data (Stage of construction 2)****Geological profile and assigned soils**

No.	Thickness of layer t [ft]	Depth z [ft]	Assigned soil	Pattern
1		- 0.00 .. $\infty$	Retained Soils	

**Terrain profile**

No.	Coordinates x [ft]	Depth z [ft]
1	0.00	0.00
2	3.00	0.00
3	18.00	-5.00
4	19.00	-5.00

Origin [0,0] is located in upper right edge of construction.

Positive coordinate +z has downward direction.

**Water influence**

Ground water table is located below the structure.

**Resistance on front face of the structure**

Resistance on front face of the structure is not considered.

**Earthquake**Factor of horizontal acceleration  $K_h = 0.3000$ Factor of vertical acceleration  $K_v = 0.0000$ 

Water below the GWT is restricted.

**Settings of the stage of construction**

Design situation : seismic

Reduction of soil/soil friction angle : do not reduce

**Verification No. 1 (Stage of construction 2)****Forces acting on construction**

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.72	4303.1	2.77	1.000
Earthq.- constr.	1292.3	-3.79	0.0	2.75	1.000
Weight - earth wedge	0.0	-0.87	36.3	5.68	1.000
Earthquake - soil wedge	10.9	-0.87	0.0	5.68	1.000
Weight - earth wedge	0.0	-5.36	447.2	4.41	1.000
Earthquake - soil wedge	134.2	-5.36	0.0	4.41	1.000

Name	F <sub>hor</sub> [lbf/ft]	App.Pt. z [ft]	F <sub>vert</sub> [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - earth wedge	0.0	-9.29	98.1	2.50	1.000
Earthquake - soil wedge	29.4	-9.29	0.0	2.50	1.000
Active pressure	1747.2	-3.16	2116.7	5.25	1.000
Earthq.- act.pressure	3931.0	-6.48	5998.3	4.32	1.000

**Verification of complete wall****Check for overturning stability**Resisting moment  $M_{res} = 51342.4$  lbfft/ftOverturning moment  $M_{ovr} = 36907.9$  lbfft/ft

Safety factor = 1.39 &gt; 1.12

**Wall for overturning is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 8768.40$  lbf/ftActive horizontal force  $H_{act} = 7144.94$  lbf/ft

Safety factor = 1.23 &gt; 1.12

**Wall for slip is SATISFACTORY****Overall check - WALL is SATISFACTORY****Dimensioning No. 1 (Stage of construction 2)****Forces acting on construction**

Name	F <sub>hor</sub> [lbf/ft]	App.Pt. z [ft]	F <sub>vert</sub> [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.56	3913.1	2.24	1.000
Earthq.- constr.	1179.7	-3.63	0.0	2.23	1.000
Weight - earth wedge	0.0	-4.86	447.2	3.91	1.000
Earthquake - soil wedge	134.2	-4.86	0.0	3.91	1.000
Weight - earth wedge	0.0	-8.79	98.1	2.00	1.000
Earthquake - soil wedge	29.4	-8.79	0.0	2.00	1.000
Active pressure	1448.6	-3.20	1487.1	4.49	1.000
Earthq.- act.pressure	3446.6	-6.17	5251.5	3.76	1.000

**Verification of most stressed block No. 1****Check for overturning stability**Resisting moment  $M_{res} = 37152.7$  lbfft/ftOverturning moment  $M_{ovr} = 31074.2$  lbfft/ft

Safety factor = 1.20 &gt; 1.12

**Joint for overturning stability is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 9395.36$  lbf/ftActive horizontal force  $H_{act} = 6238.56$  lbf/ft



Safety factor = 1.51 > 1.12

**Joint for verification is SATISFACTORY**

### Bearing capacity of foundation soil (Stage of construction 2)

Design load acting at the center of footing bottom

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]	Eccentricity [-]	Stress [psf]
1	24564.6	12999.69	7144.94	0.315	5853.8

Service load acting at the center of footing bottom

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]
1	24564.6	12999.69	7144.94

#### Verification of foundation soil

Stress in the footing bottom : rectangle

#### Eccentricity verification

Max. eccentricity of normal force  $e = 0.315$

Maximum allowable eccentricity  $e_{alw} = 0.333$

**Eccentricity of the normal force is SATISFACTORY**

#### Verification of bearing capacity

Max. stress at footing bottom  $\sigma = 5853.8$  psf

Allowable bearing capacity of foundation soil  $R_d = 9000.0$  psf

Safety factor = 1.54 > 1.50

**Bearing capacity of foundation soil is SATISFACTORY**

**Overall verification - bearing capacity of found. soil is SATISFACTORY**


## Analysis of Redi Rock wall

### Input data (Stage of construction 1)

Project : 7.5 FOOT WALL WITH 2H:1V SLOPE  
Part : Wall B  
Customer : BRADLEY HEIGHTS SS,LLC  
Author : AES  
Date : 5/14/2025  
Project ID : TIMBERLANE.BRADLEY HEIGHTS

Name : 9 foot with slopes

Stage - analysis : 1 - 0

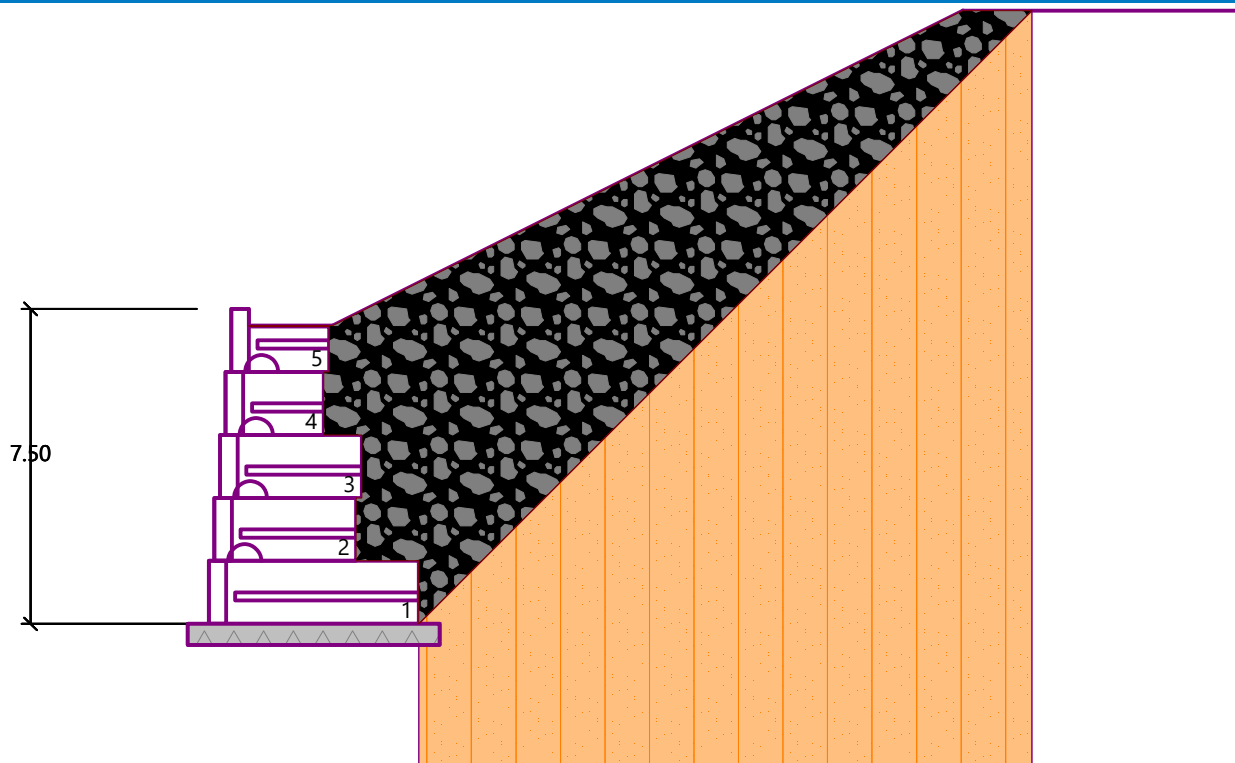

### Settings

(input for current task)

### Wall analysis

Verification methodology :	Safety factors (ASD)
Active earth pressure calculation :	Coulomb
Passive earth pressure calculation :	Mazindrani (Rankine)
Earthquake analysis :	Mononobe-Okabe
Shape of earth wedge :	Calculate as skew
Allowable eccentricity :	0.333
Internal stability :	Standard - straight slip surface
Reduction coeff. of contact first block - base :	1.00

### Safety factors

#### Permanent design situation

Safety factor for overturning :	$SF_o =$	1.50	[-]
Safety factor for sliding resistance :	$SF_s =$	1.50	[-]

Safety factors			
Permanent design situation			
Safety factor for bearing capacity :	$SF_b =$	2.00	[-]
Safety factor for sliding along geo-reinforcement :	$SF_{sr} =$	1.50	[-]
Safety factor for geo-reinforcement strength :	$SF_{st} =$	1.50	[-]
Safety factor for pull out resistance of geo-reinf. :	$SF_{po} =$	1.50	[-]
Safety factor for connection strength :	$SF_{con} =$	1.50	[-]

Safety factors			
Seismic design situation			
Safety factor for overturning :	$SF_o =$	1.12	[-]
Safety factor for sliding resistance :	$SF_s =$	1.12	[-]
Safety factor for bearing capacity :	$SF_b =$	1.50	[-]
Safety factor for sliding along geo-reinforcement :	$SF_{sr} =$	1.12	[-]
Safety factor for geo-reinforcement strength :	$SF_{st} =$	1.12	[-]
Safety factor for pull out resistance of geo-reinf. :	$SF_{po} =$	1.12	[-]
Safety factor for connection strength :	$SF_{con} =$	1.12	[-]

### Blocks

No.	Description	Block height h [in]	Block width w [in]	Unit weight γ [pcf]
1	Block 28	18.00	28.00	142.00
2	Block 41	18.00	40.50	142.00
3	Block 60	18.00	60.00	142.00
4	Top block 28	18.00	28.00	120.00

No.	Description	Shear bearing capacity of joint $F_{min}$ [lbf/ft]	Max. shear strength $F_{max}$ [lbf/ft]	Block friction f [°]
1	Block 28	6061.00	11276.00	44.00
2	Block 41	6061.00	11276.00	44.00
3	Block 60	6061.00	11276.00	44.00
4	Top block 28	6061.00	11276.00	44.00

### Setbacks

No.	Setback s [in]
1	0.000
2	0.033
3	0.135
4	0.781
5	1.385




**Geometry**

No. group	Description	Count	Setbacks [in]
1	Block 60	1	0.13
2	Block 41	2	0.13
3	Block 28	1	0.13
4	Top block 28	1	-

**Base****Geometry**Upper setback  $a_1 = 0.50$  ftLower setback  $a_2 = 0.50$  ftHeight  $h = 0.50$  ftWidth  $b = 6.00$  ft**Material**

Soil creating foundation - CSTC

**Basic soil parameters**

No.	Name	Pattern	$\Phi_{ef}$ [°]	$C_{ef}$ [psf]	$\gamma$ [pcf]	$\gamma_{su}$ [pcf]	$\delta$ [°]
1	Retained Soils		34.00	0.0	130.00	67.50	22.78
2	CSTC		40.00	0.0	130.00	67.50	26.80
3	Structural Fill		36.00	0.0	130.00	67.50	24.12

All soils are considered as cohesionless for at rest pressure analysis.

**Soil parameters****Retained Soils**Unit weight :  $\gamma = 130.0$  pcf

Stress-state : effective

Angle of internal friction :  $\Phi_{ef} = 34.00^\circ$ Cohesion of soil :  $C_{ef} = 0.0$  psfAngle of friction struc.-soil :  $\delta = 22.78^\circ$ Saturated unit weight :  $\gamma_{sat} = 130.0$  pcf**CSTC**Unit weight :  $\gamma = 130.0$  pcf

Stress-state : effective

Angle of internal friction :  $\Phi_{ef} = 40.00^\circ$ Cohesion of soil :  $C_{ef} = 0.0$  psfAngle of friction struc.-soil :  $\delta = 26.80^\circ$ Saturated unit weight :  $\gamma_{sat} = 130.0$  pcf**Structural Fill**Unit weight :  $\gamma = 130.0$  pcf

Stress-state : effective


Angle of internal friction :  $\Phi_{ef} = 36.00^\circ$ Cohesion of soil :  $C_{ef} = 0.0$  psf

Angle of friction struc.-soil :  $\delta = 24.12^\circ$   
Saturated unit weight :  $\gamma_{\text{sat}} = 130.0 \text{ pcf}$

### Backfill

Assigned soil : Structural Fill  
Slope =  $45.00^\circ$

### Geological profile and assigned soils

No.	Thickness of layer t [ft]	Depth z [ft]	Assigned soil	Pattern
1		- 0.00 .. $\infty$	Retained Soils	

### Terrain profile

Depth of terrain below the top of wall h = 0.40 ft.

No.	Coordinates x [ft]	Depth z [ft]
1	0.00	0.00
2	2.00	0.00
3	17.00	-7.50
4	18.00	-7.50

Origin [0,0] is located in upper right edge of construction.  
Positive coordinate +z has downward direction.

### Water influence

Ground water table is located below the structure.

### Resistance on front face of the structure

Resistance on front face of the structure is not considered.

### Settings of the stage of construction

Design situation : permanent  
Reduction of soil/soil friction angle : do not reduce

### Verification No. 1 (Stage of construction 1)

### Forces acting on construction

Name	$F_{\text{hor}}$ [lbf/ft]	App.Pt. z [ft]	$F_{\text{vert}}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.15	3717.9	2.57	1.000
Weight - earth wedge	0.0	-4.17	690.0	4.34	1.000
Active pressure	1642.8	-2.61	2089.8	5.25	1.000

### Verification of complete wall

#### Check for overturning stability

Resisting moment  $M_{\text{res}} = 23511.0 \text{ lbfft/ft}$   
Overturning moment  $M_{\text{ovr}} = 4289.2 \text{ lbfft/ft}$

Safety factor =  $5.48 > 1.50$

**Wall for overturning is SATISFACTORY**

#### Check for slip

Resisting horizontal force  $H_{\text{res}} = 4382.72 \text{ lbf/ft}$



Active horizontal force  $H_{act} = 1642.76$  lbf/ft

Safety factor = 2.67 > 1.50

**Wall for slip is SATISFACTORY**

**Overall check - WALL is SATISFACTORY**

### Dimensioning No. 1 (Stage of construction 1)

#### Forces acting on construction

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-2.99	3327.9	2.02	1.000
Weight - earth wedge	0.0	-3.86	612.0	3.73	1.000
Active pressure	1323.3	-2.57	1464.0	4.45	1.000

#### Verification of most stressed block No. 1

##### Check for overturning stability

Resisting moment  $M_{res} = 15509.3$  lbfft/ft

Overturning moment  $M_{ovr} = 3397.7$  lbfft/ft

Safety factor = 4.56 > 1.50

**Joint for overturning stability is SATISFACTORY**

##### Check for slip

Resisting horizontal force  $H_{res} = 4534.35$  lbf/ft

Active horizontal force  $H_{act} = 1323.33$  lbf/ft

Safety factor = 3.43 > 1.50

**Joint for verification is SATISFACTORY**

### Bearing capacity of foundation soil (Stage of construction 1)

#### Design load acting at the center of footing bottom

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]	Eccentricity [-]	Stress [psf]
1	271.1	6497.65	1642.76	0.007	1098.2

#### Service load acting at the center of footing bottom

No.	Moment [lbfft/ft]	Norm. force [lbf/ft]	Shear Force [lbf/ft]
1	271.1	6497.65	1642.76

#### Verification of foundation soil

Stress in the footing bottom : rectangle

##### Eccentricity verification

Max. eccentricity of normal force  $e = 0.007$

Maximum allowable eccentricity  $e_{alw} = 0.333$

**Eccentricity of the normal force is SATISFACTORY**

#### Verification of bearing capacity

Max. stress at footing bottom  $\sigma = 1098.2$  psf  
Allowable bearing capacity of foundation soil  $R_d = 6000.0$  psf


Safety factor = 5.46 > 2.00

**Bearing capacity of foundation soil is SATISFACTORY**

**Overall verification - bearing capacity of found. soil is SATISFACTORY**

### Input data (Stage of construction 2)

#### Geological profile and assigned soils

No.	Thickness of layer t [ft]	Depth z [ft]	Assigned soil	Pattern
1		- 0.00 .. $\infty$	Retained Soils	

#### Terrain profile

Depth of terrain below the top of wall h = 0.40 ft.

No.	Coordinates x [ft]	Depth z [ft]
1	0.00	0.00
2	2.00	0.00
3	17.00	-7.50
4	18.00	-7.50

Origin [0,0] is located in upper right edge of construction.  
Positive coordinate +z has downward direction.

#### Water influence

Ground water table is located below the structure.

#### Resistance on front face of the structure

Resistance on front face of the structure is not considered.

#### Earthquake

Factor of horizontal acceleration  $K_h = 0.2550$

Factor of vertical acceleration  $K_v = 0.0000$

Water below the GWT is restricted.

#### Settings of the stage of construction

Design situation : seismic

Reduction of soil/soil friction angle : do not reduce

### Verification No. 1 (Stage of construction 2)

#### Forces acting on construction

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-3.15	3717.9	2.57	1.000
Earthq.- constr.	946.9	-3.17	0.0	2.56	1.000
Weight - earth wedge	0.0	-4.17	690.0	4.34	1.000
Earthquake - soil wedge	175.9	-4.17	0.0	4.34	1.000
Active pressure	1642.8	-2.61	2089.8	5.25	1.000
Earthq.- act.pressure	5508.7	-5.14	7571.6	4.49	1.000

**Verification of complete wall****Check for overturning stability**Resisting moment  $M_{res} = 57493.3 \text{ lbfft/ft}$ Overturning moment  $M_{ovr} = 36365.2 \text{ lbfft/ft}$ 

Safety factor = 1.58 &gt; 1.12

**Wall for overturning is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 9489.82 \text{ lbf/ft}$ Active horizontal force  $H_{act} = 8274.39 \text{ lbf/ft}$ 

Safety factor = 1.15 &gt; 1.12

**Wall for slip is SATISFACTORY****Overall check - WALL is SATISFACTORY**

Warning - allowable range of input data exceeded during earthquake analysis!

The analysis is carried out with the modified value of terrain inclination  $\beta$ . ( $\beta=26.57^\circ$ ,  $\beta_{modif}=19.69^\circ$ )**Dimensioning No. 1 (Stage of construction 2)****Forces acting on construction**

Name	$F_{hor}$ [lbf/ft]	App.Pt. z [ft]	$F_{vert}$ [lbf/ft]	App.Pt. x [ft]	Design coefficient
Weight - wall	0.0	-2.54	2262.9	1.66	1.000
Earthq.- constr.	577.7	-2.58	0.0	1.65	1.000
Weight - earth wedge	0.0	-3.66	116.1	2.96	1.000
Earthquake - soil wedge	29.6	-3.66	0.0	2.96	1.000
Weight - earth wedge	0.0	-5.59	4.1	1.78	1.000
Earthquake - soil wedge	1.1	-5.59	0.0	1.78	1.000
Active pressure	670.9	-2.03	472.0	3.30	1.000
Earthq.- act.pressure	2433.0	-3.90	2943.4	3.09	1.000

**Verification of most stressed block No. 2****Check for overturning stability**Resisting moment  $M_{res} = 14754.9 \text{ lbfft/ft}$ Overturning moment  $M_{ovr} = 12460.0 \text{ lbfft/ft}$ 

Safety factor = 1.18 &gt; 1.12

**Joint for overturning stability is SATISFACTORY****Check for slip**Resisting horizontal force  $H_{res} = 11276.00 \text{ lbf/ft}$ Active horizontal force  $H_{act} = 3712.18 \text{ lbf/ft}$ 

Safety factor = 3.04 &gt; 1.12

**Joint for verification is SATISFACTORY****Bearing capacity of foundation soil (Stage of construction 2)****Design load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lb/ft]	Shear Force [lb/ft]	Eccentricity [-]	Stress [psf]
1	21079.7	14069.24	8274.39	0.250	4684.4

**Service load acting at the center of footing bottom**

No.	Moment [lbfft/ft]	Norm. force [lb/ft]	Shear Force [lb/ft]
1	21079.7	14069.24	8274.39

**Verification of foundation soil**

Stress in the footing bottom : rectangle

**Eccentricity verification**

Max. eccentricity of normal force  $e = 0.250$

Maximum allowable eccentricity  $e_{alw} = 0.333$

**Eccentricity of the normal force is SATISFACTORY**

**Verification of bearing capacity**

Max. stress at footing bottom  $\sigma = 4684.4$  psf

Allowable bearing capacity of foundation soil  $R_d = 12000.0$  psf

Safety factor = 2.56 > 1.50


**Bearing capacity of foundation soil is SATISFACTORY**

**Overall verification - bearing capacity of found. soil is SATISFACTORY**

## **Appendix B**

### Block Manufacturer Standard Details

## Typical Gravity Wall Section

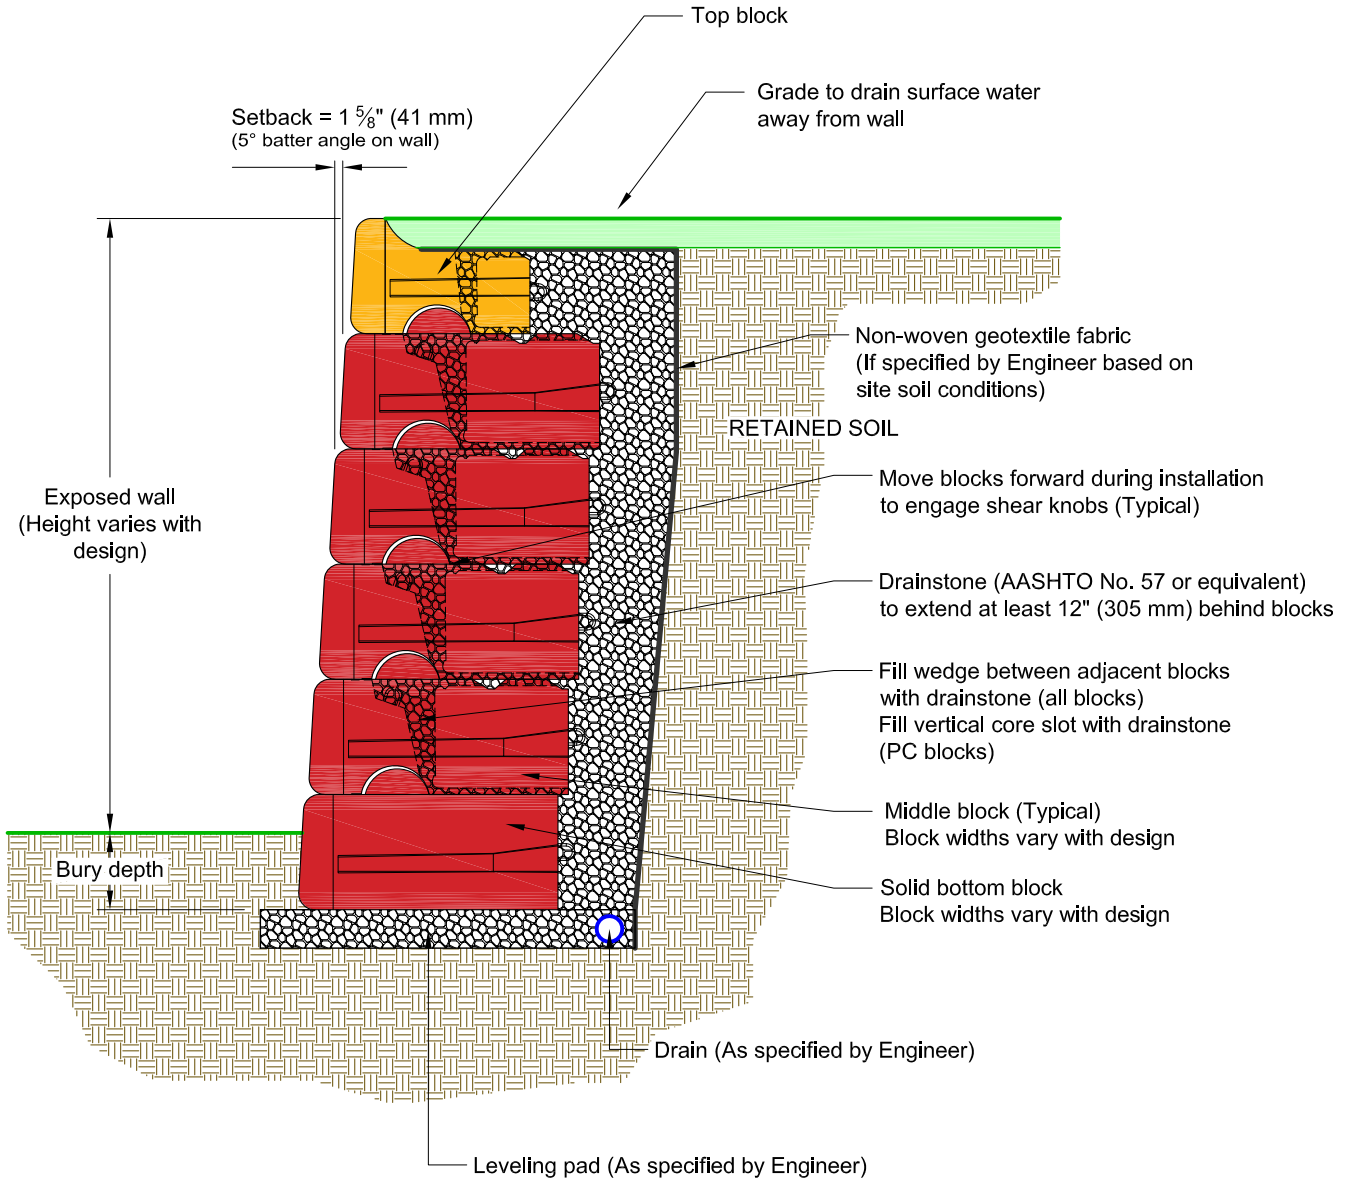

This drawing is for reference only. Determination of the suitability and/or manner of use of any details contained in this document is the sole responsibility of the design engineer of record. Final project designs, including all construction details, shall be prepared by a licensed professional engineer using the actual conditions of the proposed site.


DRAWN BY:	JRJ	TITLE:  Typical Gravity Wall Detail	 05481 US 31 SOUTH, CHARLEVOIX, MI 49720 (866) 222-8400 ext 3010 • <a href="mailto:engineering@redi-rock.com">engineering@redi-rock.com</a> <a href="http://www.redi-rock.com">www.redi-rock.com</a>
APPROVED BY:	JRJ		
DATE:	17MAR2016		
SHEET:	1 of 1		



## BLOCK-TO-BLOCK SETBACK OPTIONS


NO SCALE

### Five degree (5°) setback (Standard)

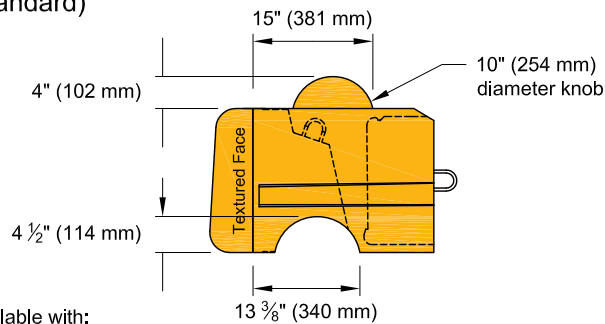

Setback =  $1 \frac{5}{8}$ " (41 mm)  
(5° batter angle on wall)


Move blocks forward during  
installtion to engage shear  
knobs (Typical)

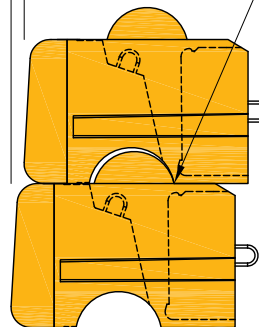

Available with:


- 28" (710 mm) blocks, 41" (1030 mm) blocks, and 60" (1520 mm) blocks
- 28" (710 mm) PC blocks (shown here) and 41" (1030 mm) PC blocks

### One degree (1°) setback (Specialty)

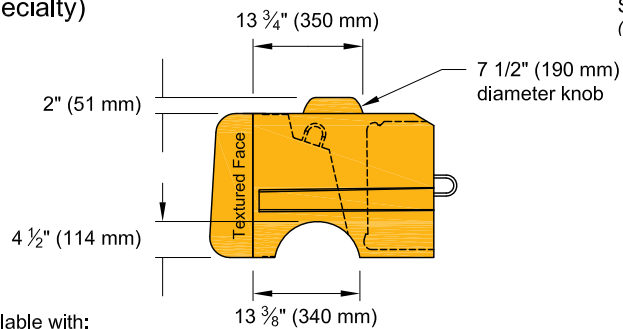

Setback =  $\frac{3}{8}$ " (10 mm)  
(1° batter angle on wall)


Move blocks forward during  
installtion to engage shear  
knobs (Typical)

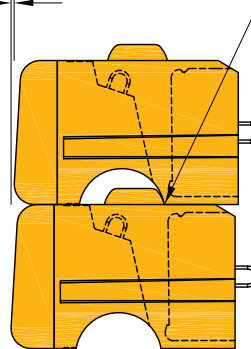

Available with:


- 28" (710 mm) blocks, 41" (1030 mm) blocks, and 60" (1520 mm) blocks
- 28" (710 mm) PC blocks (shown here) and 41" (1030 mm) PC blocks

### Zero (0°) setback (Specialty)

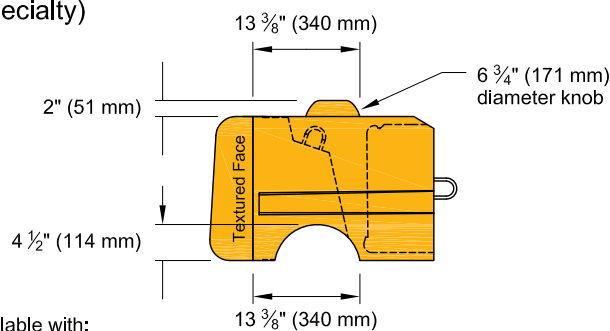

Setback = 0" (0 mm)  
(0° batter angle on wall)

Move blocks forward during  
installtion to engage shear  
knobs (Typical)

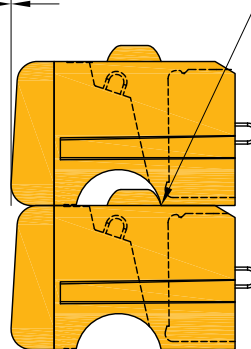

Available with:

- 28" (710 mm) blocks, 41" (1030 mm) blocks, and 60" (1520 mm) blocks
- 28" (710 mm) PC blocks (shown here) and 41" (1030 mm) PC blocks

The block-to-block setback available with Redi-Rock is controlled by the size and location of the shear knobs (domes) cast into the blocks. While the 10" (254 mm) diameter knob and the  $1 \frac{5}{8}$ " (41 mm) setback position is the most common configuration, Redi-Rock has three different knob sizes and three different locations available.

DRAWN BY: JRJ  
APPROVED BY: JRJ  
DATE: 06-22-2015  
SHEET: 1 of 1

TITLE:

### Block Setback Options Normal Batter

FILE: 4 Block Setback Options Normal Batter 062215.dwg

**REDI-ROCK®**  
05481 US 31 SOUTH, CHARLEVOIX, MI 49720  
(866) 222-8400 ext 3010 • [engineering@redi-rock.com](mailto:engineering@redi-rock.com)  
[www.redi-rock.com](http://www.redi-rock.com)